

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga	Located In:	Corner Code #
(County)		
1. Public Land Survey	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u>11</u> T <u>52N</u> R <u>31W</u>	<u>7</u>
	S <u>11</u> T <u>52N</u> R <u>31W</u>	<u>9</u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
 5. Private Claims

Oct 30 2001

I, Stephan J. Szyszkoski, in a field survey on , 20 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													


A. Description of original monument and accessories and/or subsequent restoration:
 (7-Sec. 11) North 1/16 corner between Sections 11 and 12. Not established in the original survey. The line between these two sections has been monumented previously by Robert W. Crampton PS in a 2 Jun 1998 survey (drawing no. L-3-1740).
 (9-Sec. 11) East 1/16 corner Sec. 11. Not established in the original survey. This section was partially subdivided in 1998 by R.W.Crampton PS.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(7-Sec. 11) Established the corner on the Section line as previously monumented by Mr. Crampton and at 1323.53' south of the Section corner. The distance being in accord with the scheme laid out in the 1998 survey subdividing this fractional section.
 (9-Sec. 11) Established the corner 1319.78' easterly of the Center of Section 11 and on a line parallel with the north line of Section 11. The distance used is one-half of that measured between the North 1/4 corner of Section 11 and the Northeast corner of Section 11. This method creates regular and uniform quarter-quarter sections within the fractional NE1/4 of Section 11.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(7) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Blazed and scribed: 7" Maple N41E 54.4' "1/16S 8T" 7" Maple (S'yly of 2) N86E 61.8' do 4" Y. Birch S43W 18.5' do 7" Maple N31W 34.8' do Squared spruce post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.	(9) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Blazed and scribed: 4" Sugar N39E 49.6' "1/16S 8T" 3" Maple S06W 9.9' do 8" Sugar N84W 47.4' do 10" Sugar N58W 68.0' do Placed a squared spruce post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.
--	---

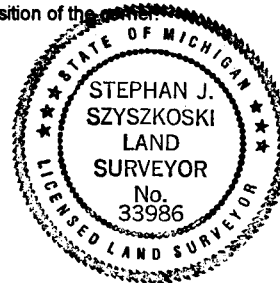

Signed by Stephan J. Szyszkoski Date 3/19/02
 Surveyor's Michigan License No. 33986