

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 52 N. R. 33 K. W.	G-1, D-1
2. PROPERTY CONTROL - ING IN SECTION	5, T. 52 N. R. 33 K. W.	2
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970 the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19\_\_\_\_ established or re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 1 and 2 and 3 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or by a Decree of a Court of law.

A. Description of original monument and accessories and/or subsequent restoration

- Corner G-1: Original monument and accessories not found. Found old post by P. A. Larsen.
- Corner D-1: Original monument not found. Found possible BT stumps too far decayed for positive identification. Also found old post by P. A. Larsen set from original evidence.
- Corner 2: Not set on original survey nor subsequently apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- Corner G-1: Re-established 5/2/77 at old post location. Fits good with other corners in area.
- Corner D-1: Re-established by 5/3/77 at old post. Fits good with swamp edge and other corners in area.
- Corner 2: Established 5/20/77 on line between corners east and west.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner

- |  |  |
|--|--|
| <p><u>Corner G-1:</u> Set 1" I.D. x 36" iron pipe with 4" aluminum cap.</p> <p>6" Cedar S01°E 23.0' S3, NBT<br/>6" Tamarack N60°W 16.9' S33, NBT<br/>6" Spruce S56°W 18.3' S4, NBT<br/>Tamarack stub N83°E 12.9' with P. A. Larsen marks</p> | <p><u>Corner 2:</u> Set 1" I.D. x 36" iron pipe with 4" aluminum cap.</p> <p>3" Aspen N32°W 15.6' 1/16S, BT<br/>3" Maple N78°E 14.4' 1/16S, BT<br/>4" Maple S19°W 21.9' 1/16S, BT<br/>10" Aspen squared N37°E 4.5'</p> |
|--|--|
- Corner D-1: Set 1" I.D. x 36" iron pipe with 4" alum. cap in open marsh. No available BT.

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_


SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY Keith L. Sackett DATE August 3, 1977  
CHEF OF SURVEY PARTY  
 MICHIGAN REGISTERED LAND SURVEYOR  
 Keith L. Sackett  
 Michigan Dept. of Natural Resources

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006

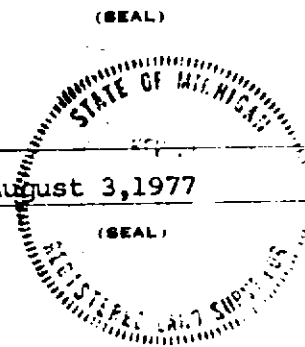

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 26, 1971  
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET