

**SURVEY &  
REMONUMENTATION**

1993

**COMMISSION**

Barry County Remonumentation

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
COUNTY OF BARRY  
RECEIVED FOR RECORD

MAY 14 11 08 AM '93

Sandy Schondelmar

REGISTER OF DEEDS

For corners in

Barry

(County)

Located In:

Corner Code #

- |                                    |   |    |   |     |                  |
|------------------------------------|---|----|---|-----|------------------|
| 1. Public Land Survey              | T | 2N | R | 10W | E-7 (SE, 17)     |
|                                    | T |    | R |     | Orangeville Twp. |
|                                    | T |    | R |     |                  |
|                                    | T |    | R |     |                  |
|                                    | T |    | R |     |                  |
| 2. Property Controlling in Section | S |    | T | R   |                  |
|                                    | S |    | T | R   |                  |
| 3. Miscellaneous Property in Sec.  | S |    | T | R   |                  |
|                                    | S |    | T | R   |                  |
4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

**002007**

Register of Deeds Stamp & File Number

I, John C. Bueche in a field survey on January, 1993

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**


	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

- A. Description of original monument and accessories and/or subsequent restoration:
- E-7 MDNR 1947 LCRC #46, Dec., 1972
  - Found bot. of cor. fence MDNR mon.
  - post with stones & old nails 6" Oak S 70° E 7.8'
  - around it 12" Walnut S 35° E 27.7'
  - Set 4" x 60" conc. post with brass 8" Walnut N 80° E 28.7'
  - plate 8" above ground 22" Cherry E 41.9'
  - "V" notch in face of 20" Cherry 24" Oak S 05° E 85.7'
  - N 88° 50' E 42.25'
  - "V" notch in face of 16" W. Oak N 89° 20' W 69.20'
  - "V" notch in face of 24" W. Oak S 01° 15' E 85.60'
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- E-7 Found MDNR mon. dated 1947 22" Cherry S 41.9'
- Face of 20" Cherry N 89° E 42.25'± 24" Oak S 05° E 85.7'
- Face of 24" W. Oak S 01° E 86'±
- Face of 16" W. Oak N 89° W 70'±

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- E-7 MDNR mon. dated 1947
- Blaze & 40d nail in W side 14" Poplar N 20° E 37.66'
- Blaze & 40d nail in W side 12" Poplar N 30° W 16.58'
- Blaze & 40d nail in S side 12" Oak N 90° E 33.01'
- Blaze & 40d nail in W side 16" Poplar S 55° E 52.18'
- Blaze & 40d nail in W side 8" Elm S 10° E 43.50'
- Blaze & 40d nail in S side 10" Poplar N 70° W 40.88'
- C/L gravel rd. extended E is South 15'±
- C/L gravel rd. extended N is West 15'±
- Meas. by hand

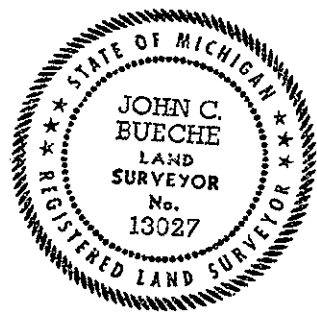

Signed by John C. Bueche Date 1-27-93

Surveyor's Michigan License No. 13027