

**SURVEY & REMONUMENTATION**

JUL 24 1997

Commission

**BARRY COUNTY REMONUMENTATION**

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
BARRY COUNTY  
RECORDED

17 JUN 97 12:20 P.M.

SANDY SCHONDELMAYER  
REGISTER OF DEEDS

**002501**

Register of Deeds Stamp & File Number

For Corners in BARRY Located In: Corner Code #  
(county)

1. Public Land Survey T 3N R 7W C-9  
CORNER COMMON TO T \_\_\_\_\_ R \_\_\_\_\_  
SECTIONS 19, 20, 29, & 30 T \_\_\_\_\_ R \_\_\_\_\_  
CASTLETON TOWNSHIP T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		6		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, **Brian Reynolds**, in a field survey on 17 OCTOBER, 1996 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- GENERAL LAND OFFICE: SYLVESTER SIBLEY, D.S., 1830 (R7W,P.114) A BEECH 8 N72W 4 Do. 5 S33E 14
- LAND CORNER RECORDATION CERTIFICATE: #325 BY HENRY J. MULDER, P.S.#25862"SET 1/2" CAPPED IRON ROD" S.SE. 22.53' NAIL & TAG IN W. SIDE 15" WILD CHERRY S 10.65' NAIL & TAG IN E. SIDE 20" OAK W. 26.09' NAIL & TAG IN N. SIDE 40" OAK E. 3.95' PK IN S. SIDE 4" ASH N.E. 3.57' NAIL & TAG IN S. SIDE R.R. TIE FNC POST
- ACT 132 SURVEY: BY HENRY J. MULDER, P.S.#25862 (L1,P.724-725) & (L.1,P.796) RECITE SAME WITNESSES AS IN L.C.R.C. #325 ABOVE

\*\*\* NO OTHER RECORDED HISTORICAL INFORMATION AVAILABLE FOR THIS CORNER \*\*\*

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" CAPPED IRON AND ALL OF MULDER'S WITNESSES (MOSTLY OVERGROWN)  
FOUND IRON CONFORMS VERY WELL WITH CORRESPONDING CORNERS AND OCCUPATION THROUGHOUT SECTION.  
ACCEPTED FOUND 1/2" CAPPED IRON AS BEST EVIDENCE OF CORNER POSITION  
REPLACED FOUND IRON BY MULDER WITH STANDARD BARRY COUNTY REMONUMENTATION MONUMENT


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT (3/4" X 36" IRON) WITH ALUMINUM CAP.  
FOUND NAIL W/TAG IN THE SOUTHEAST SIDE OF A R/R TIE CORNER POST N30°E 3.55'  
SET 20d NAIL W/REMON TAG IN THE SOUTH SIDE OF A 4" MAPLE DUE EAST 3.95'  
SET 20d NAIL W/REMON TAG IN THE EAST SIDE OF A 30" OAK S3°W 10.54'  
SET 20d NAIL W/REMON TAG IN THE SOUTH SIDE OF A 40" OAK DUE WEST 26.47'  
SET 20d NAIL W/REMON TAG IN THE WEST SIDE OF A 24" CHERRY S3°E 22.30'  
IN LINE WITH FENCE RUNNING NORTH.

APPROVED BY PEER REVIEW AT A MEETING HELD ON

3-11-96  
BRIAN REYNOLDS

BR  
COUNTY SURVEYOR

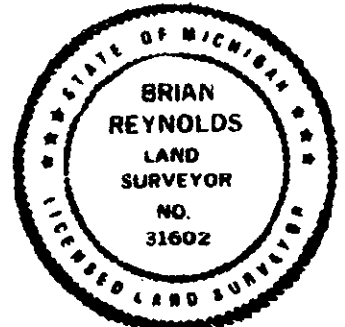

Signed by [Signature]  
Surveyor's Michigan License No 31602

Date MAY 16, 1997