

SURVEY & REMONUMENTATION

APR 26 1995

COMMISSION

Barry County Remonumentation
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
 COUNTY OF BARRY
 RECEIVED FOR RECORD

DEC 7 3 11 PM '94

Sandy Schindelmayr
 REGISTER OF DEEDS

002247

Register of Deeds Stamp & File Number

For corners in

Barry (County)	Located In:	Corner Code #
	Yankee Springs Twp.	
1. Public Land Survey	T <u>3N</u> R <u>10W</u>	<u>E-7</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert Jonker, in a field survey on October 4, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration: From Exxel Eng: old DNR wit. call for sleigh shoe.
 B.L.O. survey, 1830-1831, Sylvester Sibley D.S.
 A Pine 15 N 25° E 11
 A Pine 5 S 38° 12
 Co. Surveyor, Heath, 1904, Fd. stumps
 of both bearing trees and set post.
 No info. from Co. Road Commission.
 Jonker, 1991, Fd. sleigh shoe per Exxel wit.
 Took witnesses: (same as "C" below)

1990 Exxel Eng. found 1"x1 3/4" sleigh shoe in conc: Took witnesses of
 Nail in S. side 9° Oak N68°W 15.90'
 Nail in NW side 22° Oak N45°E 4.83'
 Nail in W. side 24° Oak S30°W 43.61'
 1" Pipe N90°E 22.12'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found sleigh shoe per Exxel Eng. witnesses & Jonker witnesses.

ACT 345 BARRY COUNTY REMONUMENTATION
 APPROVED BY PEER REVIEW AT A MEETING HELD ON

OCT 4, 1994 ISR
 BRIAN REYNOLDS COUNTY SURVEYOR


Accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Left sleigh shoe - took new witnesses

Nail 20" Oak N 40° E 4.80'
 Nail 20" Oak S 30° W 43.6'
 Nail 10" Oak N 65° W 15.94'
 Exxel capped Iron S 85° W 31.54'

Note: Nails are Barry County N&T's.

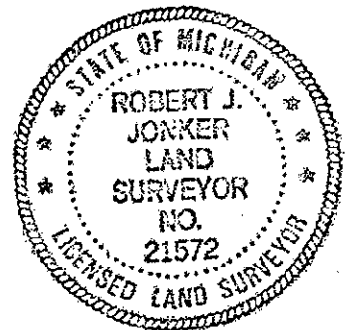

Signed by Robert J. Jonker Date November 01, 1994
 Surveyor's Michigan License No. JONKER LAND SURVEYS 21572