


FEB 03 1999

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For Corners in BARRY Located In: Corner Code #
(county)

1. Public Land Survey T 4N R 7W Corner Code # A-9
CORNER COMMON TO T _____ R _____
SECTIONS 19 & 30 T _____ R _____
WOODLAND TOWNSHIP T _____ R _____
ON RANGE LINE T _____ R _____
2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____

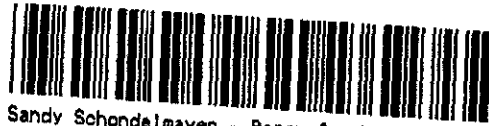

2694 Page: 1 of 1
11/25/1998 12:13P

Sandy Schondelmayer - Barry Co. LCRCR

Register of Deeds Stamp & File Number

4. Lot No _____ Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Brian Reynolds, in a field survey on 9 OCT., 1998 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 1. GENERAL LAND OFFICE: SYLVESTER SIBLEY, D.S., 1830 (R7W, P. 152) "WEST BOUNDARY 8 Lks NORTH OF POST" BEECH 7 S38E 20 Do. 8 N15 1/2 E 27
 2. COUNTY SURVEYOR RECORDS: LEE S. COBB, OCT 1894 (WOODLAND FIELD BOOK, PAGE 70) "SET STONE & BRICK" NO WITNESSES GIVEN. THE SAME RECORD INDICATES THAT COBB SET STONE AND BRICK AT THE 1/8 CORNER AND 1/4 CORNER NORTH AND AT THE CLOSING 1/4 CORNER A-8.
 3. LAND CORNER RECORDATION CERTIFICATE: #189 BY GEORGE M. YOUNG, P.S. #17640, 25 NOV., 1975 FOR CORRESPONDING STANDARD CORNER M-9 T4N R8W, "SET 1/2" REROD WITH CAP ACCORDING TO GOVERNMENT REGULATIONS" NAIL IN 24" MAPLE N05°W 50.84' NAIL IN 12" W. CHERRY N45°E 79.02' NAIL IN 15" W. CHERRY N70°E 61.47'
 4. ACT 132 SURVEY: BY GEORGE M. YOUNG, P.S. #17640, 2 DECEMBER, 1975 RECITE SAME WITNESSES AS IN #3 ABOVE FOR CORRESPONDING STANDARD CORNER M-9 T4N R8W

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
FOUND IRON AND WITNESSES FOR M-9 AS DESCRIBED IN ITEMS #3 AND 4 ABOVE. ALSO FOUND A 1/2" IRON IN A MONUMENT BOX 32.65' SE OF IRON RECORDED BY YOUNG. EXCAVATED AT 1/8 CORNER AND 1/4 CORNER POSITIONS DESCRIBED IN ITEM #2 ABOVE, RECOVERED STONE AND BRICK AT BOTH EXCAVATIONS. SUBSEQUENT TRAVERSE PROVED THE FOUND IRON IN MONUMENT BOX TO REPRESENT A-9. SUBSEQUENT EXCAVATION 4-7 FEET SOUTH OF A-9 REVEALED NO EVIDENCE OF MONUMENTATION FOR STANDARD CORNER. ATTEMPTED TO PLACE STANDARD REMONUMENTATION IRON IN PLACE OF FOUND 1/2" IRON IN MONUMENT BOX; HOWEVER, STONE BELOW MONUMENT BOX PREVENTED DIRECT PLACEMENT. BENT THE REMON IRON SUCH THAT LOWER PORTION WRAPS AROUND THE STONE, BUT THE UPPER PORTION IS VERTICAL ABOVE THE TOP OF THE STONE.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
SET STANDARD BARRY COUNTY REMONUMENTATION MONUMENT (3/4" X 36" IRON) WITH ALUMINUM CAP. FOUND NAIL W/REYNOLDS CAP IN THE EAST SIDE OF A 32" MAPLE N23°W 74.33'
FOUND 1/2" IRON ROD (GEORGE YOUNG) N52°W 29.13'
FOUND NAIL W REYNOLDS CAP IN THE SOUTHEAST SIDE OF AN 18" CHERRY N31°E 57.82'
FOUND NAIL W REYNOLDS CAP IN THE SOUTH SIDE OF A UTILITY POLE N71°E 82.05'
WEST EDGE (BASE) OF A STOP SIGN POST S19°E 47.89'
CORNER LIES ROUGHLY ON NORTH-SOUTH GRAVEL CENTERLINE
0.5'+/- SOUTH OF PAINTED EAST-WEST CENTERLINE
M-9, T4N, R8W, CARLTON TOWNSHIP LIES SOUTH 5.28'

ACT 345 BARRY COUNTY REMONUMENTATION
APPROVED BY PEER REVIEW AT A MEETING HELD ON
12 OCT '98 BR
BRIAN REYNOLDS COUNTY SURVEYOR



Signed by [Signature]
Surveyor's Michigan License No 31602

Date Nov 24, 1998