

BAY COUNTY REMONUMENTATION  
 LAND CORNER RECORDATION CERTIFICATE  
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

BAY  
 (County)

Located In: Sec. 30 Corner Code #  
 Sec. 31

- |                                    |   |           |   |          |       |       |
|------------------------------------|---|-----------|---|----------|-------|-------|
| 1. Public Land Survey              | T | <u>14</u> | R | <u>3</u> | A-11  |       |
|                                    | T | <u>14</u> | R | <u>3</u> | A-12  |       |
|                                    | T | _____     | R | _____    | _____ |       |
|                                    | T | _____     | R | _____    | _____ |       |
| 2. Property Controlling in Section | S | _____     | T | _____    | R     | _____ |
|                                    | S | _____     | T | _____    | R     | _____ |
| 3. Miscellaneous Property in Sec.  | S | _____     | T | _____    | R     | _____ |
|                                    | S | _____     | T | _____    | R     | _____ |

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Donald R. Burgin, in a field survey on October 30, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- A-11 L.C.R.C. L.002 P.235  
 A-12 Prior L.C.R.C. L.2 P.237 not accepted by Remon. peer group review, but held as East 1/4 Corner of Section 36, T14N, R2E of Midland County (M-12) per L.C.R.C. L.1 P.180 of Midland County.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- A-11 Found Mon. Box with 3/4" iron pin 1 ft. deep. Replaced with 5/8" rod & Brass Cap. Set new Monument Box at surface.  
 A-12 Set by single proportionate measurement between NW & SW corner of section on Township line. Set 5/8" rebar with Brass Cap and Monument Box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


- |   |   |
|---|---|
| <u>A-11</u><br>N 44°W 90.1 ft. to centerline gas pipeline and fiber cable warning sign post<br>N 57°E 73.98 ft. to double head nail with plastic witness tag in utility pole<br>S 16°E 69.35 ft. to nail with plastic witness tag in 12" Pine tree<br>S 40°W 39.0 ft. to West end 12.5" (inside diameter) steel pipe with filed "v" | <u>A-12</u><br>N 62°W 72.20 ft. to nail & Remon. witness tag in South face of 16" Poplar tree<br>S 42°W 99.95 ft. to nail & Remon. witness tag in SE face of 24" twin Maple tree<br>S 25°E 64.06 ft. to nail & Remon. witness tag in East face of utility pole<br>S 60°E 58.14 ft. to face 6" steel gate post, painted yellow<br>North 4.33 ft. to 3/4" pipe in NE corner Sec. 36, T14N, R2E (Midland County) |
|---|---|

Signed by Donald R. Burgin Date 12/23/93  
 Surveyor's Michigan License No. 29240

REGISTER OF DEEDS  
 BAY COUNTY, MICHIGAN  
 JAN 7 2 25 PM '94  
 RECORDED

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

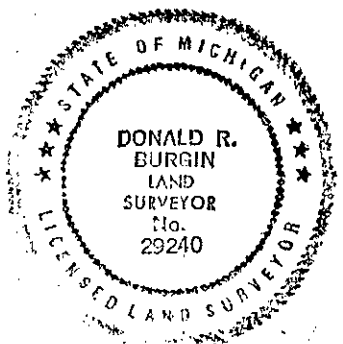

SURVEY & REMONUMENTATION  
 MAR 31 1994  
 COMMISSION