

BAY COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in	Bay	Located In:	Corner Code #
	(County)		
1. Public Land Survey		T 14 N. R 5 E.	M-8
		T _____ R _____	_____
		T _____ R _____	_____
		T _____ R _____	_____
		T _____ R _____	_____
2. Property Controlling In Section	S _____	T _____ R _____	_____
	S _____	T _____ R _____	_____
3. Miscellaneous Property in Section	S _____	T _____ R _____	_____
	S _____	T _____ R _____	_____

REGISTER OF DEEDS
 BAY COUNTY, MICHIGAN
 Dec 22 12:35 PM '95
 003 222
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Ronald C. Prevost June 22 1995
 I, _____, in a field survey on _____, 19_____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2						
3											
4	7	8	9	10	11	12					
5											
6	18	17	16	15	14	13					
7											
8	19	20	21	22	23	24					
9											
10	30	29	28	27	26	25					
11											
12	31	32	33	34	35	36					
13											

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-8 Post by Wampler 1821
 Elm 10" N.34°W. 16 L
 Ash 5" S.29°E. 14 L
 LCRC Recorded as M-8 L3 P109 Iron/Mon. Box - McGinnis - 1994
 LCRC Recorded as A-8, T.14 N.-R.6 E., L2 P618 1/2" Iron Bar - Hughes - 1989
 Old Co. Surveyors Records Iron Post
 Recorded Surveys L893 P514, L1348 P854, L719 P73, L788 P404, L866 P497, L1027 P116, L687 P347


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-8 Found 1/2" Rod in Small Mon. Box
 Distance South 2618.77 (2618.69 R)(2618.69 R)(2617.83 R)
 Distance North 2630.42 (2631.8 R) (2630.16 R)
 See Agreeing Witnesses below.
 Monument accepted as the best available evidence of the position of the original corner.

APPROVED LAND CORNER
 P.A. 345 OF 1990 - Bay County
 Date June 95
MM
 Michael MacDonald P.S.
 County Representative

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-8 Replaced 1/2" Rod with 5/8" X 24" Re-Bar with 2 3/4" Bay Co. Brass Cap in existing small Mon. Box on 8-15-95
 Nail & M.S.H.D. Tag S.W. Face P. Pole S.48°E. 43.89 (43.87 R LCRC L3 P108)
 Nail & M.S.H.D. Tag S. Face T. Pole West 31.38 (31.43 R LCRC L3 P108)
 Nail & M.S.H.D. Tag S. Face 18" Pear N.49°E 63.79 (63.75 R LCRC L3 P108)
 Ctr. Hyd. N.24°W. 112.10

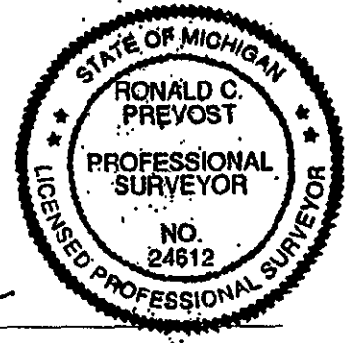

Signed by Ronald C. Prevost
 Surveyor's Michigan License No. 24612

Date 12-8-95