

**BAY COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

BAY COUNTY  
(County)

Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_

1. Public Land Survey T16N R3E \_\_\_\_\_  
T16N R4E \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_  
T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

Dec 30 3 50 PM '97  
 Register of Deeds  
 BAY COUNTY, MICHIGAN

RECORDED

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, Paul M. Ciosek, in a field survey on OCTOBER 8, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- M-10
- POST SET BY J. WAMPLER D.S. 1822  
BEECH 11" N 54° W 19 LINKS  
BEECH 14" S 28°E 22 LINKS  
CORNER IS COMMON WITH A-10, T16N, R4E
  - SURVEY, UNRECORDED, JOB #8537 (8/12/70) NO CALL
  - SURVEY, L. 779, P. 407, MCGINNIS, (1/20/76) FND 3/4" PIPE
  - LCRC, L. 2, P. 270, MAC DONALD, (3/2/76) FND 3/4" PIPE
  - SURVEY, RECORDED, SEDGMAN, (11/7/81) FND 3/8" REROD

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- M-10
- SEARCHED THE APPARENT LOCATION OF THE CORNER AND FOUND 3/8" REROD IN 3/4" PIPE 6" BELOW ROAD SURFACE. ACCEPTED 3/8" REROD IN 3/4" PIPE AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-10
- REPLACED FOUND 3/8" REROD IN 3/4" PIPE WITH A 5/8" REROD AND REMONUMENTATION CAP WITH 3/16" DRILL HOLE IN MONUMENT BOX.  
 N 40°E 79.20' SET NAIL IN WEST FACE OF PINE  
 S 65°E 23.05' SET CHISELED "X" ON EAST END CONCRETE PIPE  
 S 45°E 22.19' SET CAPPED 3/8" REROD  
 S 40°W 18.46' SET CAPPED 3/8" REROD  
 S 50°W 20.19' SET CHISELED "X" ON WEST END CONCRETE PIPE  
 N 50°W 64.25' FND N/T RLS #18664 IN SOUTH FACE U. POLE

Signed by Paul M. Ciosek  
 Surveyor's Michigan License No. 25835

Date 12/22/97

FIELD BOOK , PAGE 28

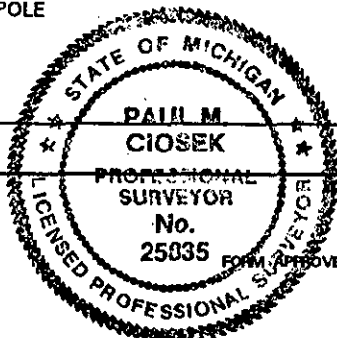

APPROVED LAND CORNER  
 P.A. 345 OF 1990 - Bay County  
 Date 23 Oct 97  
MJM  
 Michael MacDonald P.S.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 197  
 REVISED JAN., 198  
 REVISED OCT., 199

004 89