

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 25 N. R. 13 W.	B-9; C-7; C-8; D-7
2. PROPERTY CONTROLLING IN SECTION	T. N. S. R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on September 24, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration
 C. (continued)

- D-7**
- Set DNR Mon. & cedar post in line with cut in 1/4 line south
 - 3" Maple S03°W 31.3
 - 8" Tw. Y. Birch N48°E 23.6
 - 12" W. Birch N07°E 64.7
 - 8" Maple Clstr. S30°W 59.5
 - E-W Rand. Due N 12.5

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B-9** Found 3/4"x33" bolt & cedar stake, 27" below Co.Rd. surface, in one ft. square column of black dirt, as called for in 1907 survey of Sec. 29 & 30 by F. Haswell, Co. Surveyor.
- C-7** Found 1" pipe per R.L.S. H. Bruning survey of Section 17.
- C-8** Restored corner on line between SW & NW of Sec. 20 and at prorated distance to Haswell north from SW Sec. 20. This fits double the distance from NW S-20, south 1/4 mile across 1/8 line fence to east (±)2', as fence is down. Wire on stump is approx. 3' N of set iron on E'ly R-O-W.
- D-7** Restored 1/4 corner to Sec. 17 & 20 at prorated distance and alignment north one mile to Pettitt survey (deceased co. surveyor) which equals recent survey in Sec. 17 by Bruning.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-9	C-7	C-8
Found bolt & added 1"x24" pipe	Found 1" pipe in approx. ctr. of N-S gravel road	Set DNR mon. (buried 0.4') in N-S gravel road
Fence to North West 0.5'	9" S. Pine N56°W 38.25	P. Pole S70°E 36.68
Set ced. post w/loc. tag	6" R. Pine N30°E 73.65	8" Maple N70°W 53.74
Due S 33'	P. Pole S87°E 42.39	7" Maple S85°W 67.50
P. Pole N13°W 34.85	Set ced.post w/loc. tag	Set 3/4" pipe w/ced.post
8" Scotch Pine N34°W 53.65	Due W 26'	N89°53'E 33.00
Center E-W Co. Rd. Due N 2.5	Fn. E'ly&W'ly Due N 1.5'	Ctr. N'ly CMP Due S 4'
Fd. 3/4"x24" Sq. bolt S57°W 4.13		


SIGNED BY Carl F. Roser DATE 10-6-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

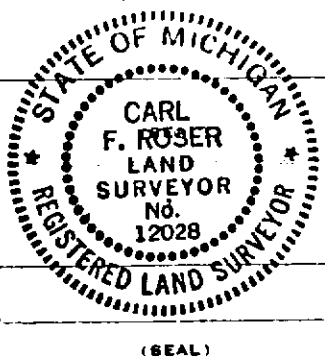

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

COLFAX TOWNSHIP
BENZIE COUNTY