

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
2. PROPERTY CONTROLLING IN SECTION	19, T. 25, N. 14, R. 14, W. 14	8; 10; 11
3. MISCELLANEOUS PROPERTY IN SECTION	19, T. 25, N. 14, R. 14, W. 14	XX = on line & midway between A-8 & corner code 10, Sec. 19.
4. LOT NO. _____	RECORDED PLAT _____	
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl E. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 18, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on August 18, 1975, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and for subsequent restoration:~~

C. (continued)

XX

Drove 1 1/2"x36" well pt. & ced.post w/loc tag
 14" Maple N53°E 20.70
 16" Maple S28°E 42.35
 Power Pole S73°W 27.80
 Fd. 24"x1" sq.iron broken prybar N12°49'E 8.56
 Ctr. dirt trail Due E 5'
 Fd. 3/4" pipe S34°00'E 30.05

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 8 Found and accepted 1/2" rerod by H. Bruning for W-1/16 on E-W 1/4 line; per G.L.O. plat.
- 10 Established S-1/16 corner on W line of Sec. 19 equidistant and on line between SW and W 1/4 of Sec. 19.
- 11 Found and accepted H. Bruning "T" iron for center of frl. SW 1/4 of Sec. 19, per G.L.O. plat
- XX Established NW corner of S 1/2 of frl. NW 1/4 of frl. SW 1/4 of Sec. 19, per G.L.O. plat.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p style="text-align: center;">8</p> <p>Set 1"x48" pipe over 1/2" rerod & cedar post w/loc. tag</p> <p>16" Cedar S02°E 40.3</p> <p>7" Cedar N44°W 26.4</p> <p>7" Cedar N78°E 32.5</p> <p>Fd. 1/2" rerod East 66.8 in N'ly edge of swale SW'ly</p>	<p style="text-align: center;">10</p> <p>Set 1 1/2"x36" pipe</p> <p>16" Tri-Maple N74°W 59.70</p> <p>Power Pole S41°W 44.37</p> <p>26" Maple N34°E 66.45</p> <p>Set ced. post w/loc. tag Due E 33.0</p> <p>Old 1/2"x18" pipe N18°W 7.8</p> <p>Ctr. N-S dirt co. road Due E 2.0</p>	<p style="text-align: center;">11</p> <p>Set 1 1/2"x36" pipe over HB "T" iron & ced.post w/loc. tag</p> <p>14" Maple N56°E 12.3</p> <p>6" Maple S14°E 11.7</p> <p>12" Maple S67°W 35.6</p> <p>18" Maple N50°W 34.7</p> <p>Old N-S fence (down) Due W 5'</p>
---	--	---


SIGNED BY Carl E. Roser 3-16-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

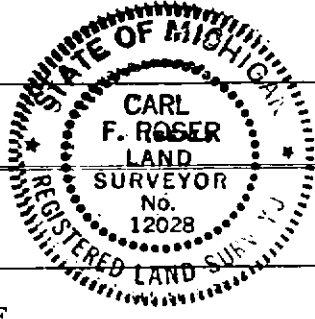

(SEAL)

WELDON TOWNSHIP
BENZIE COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____