

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 25 N. 14 W.	C-1; C-2
2. PROPERTY CONTROLLING IN SECTION 5	T. 25 N. 14 W.	3
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 12, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-1 Re-estab. closing corner to Sec's. 5 & 6, on South line of Sec. 32 (26-14) and on line across fd. 1/4 Cor. to South & fd. two inch pipe, 0.98' south. Fits C.P. Tuller Survey of S-5, May 1900.
- C-2 Fd. 3/4" pipe, with three large stones around it, for W. 1/4 Cor. Sec. 5, which fits C.P. Tuller Survey of Sec.5, dated May 1900.
- 3 Restored 1/8 Cor. on line between W 1/4 Cor. S-5, & NW Cor. S-5 (on So. Line Sec. 32) and at pro-rated distance to C.P. Tuller (equals S.P. to U.S.); see C.P. Tuller Survey Sec. 5, dated May 1900.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-1	C-2	3
Set DNR Mon. (buried) in approx. Ctr. of E-W dirt Co. Rd.	Fd. 3/4" Pipe replaced with DNR Mon. & Ced. Post	Set 5/8"X40" re-rod w/RLS cap & Ced. Post w/Loc. Tag
24" Maple S18°E 45.59	11" tw. Maple S75°W 15.6	2" Maple N37°W 16.6
16" Maple S35°W 39.90	9" Maple N23°W 33.4	12" Cherry S08°W 12.4
15" Cherry Tw. N51°W 58.44	5" Maple N19°E 26.1	4" Iron Wood S51°E 9.1
Set Ced. Post w/Loc. Tag Due So. 33'	N-S Random Due W. 11.67'	Fd. 3/4"X1" Iron S28°14'W 4.3'
Fd. 2" Pipe (buried) S00°45'E 0.98'		N-S Rand. Due W. 6.6'
Cor. to Sec's 31 & 32 (26-14) N89°38'W 276.70'		

SIGNED BY Carl F. Roser

DATE 2-12-79

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

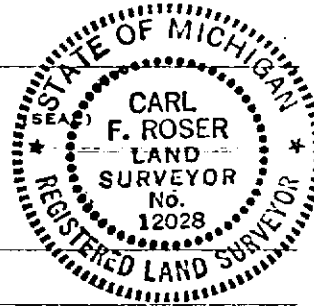

(SEAL)

WELDON TOWNSHIP
BENZIE COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____