

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF--: | LOCATED IN--: | CORNER CODE NUMBER |
|---|-------------------|--------------------|
| 1. PUBLIC LAND SURVEY..... | T. 26 N. R. 14 W. | D-13; E-13 |
| 2. PROPERTY CONTROLLING IN SECTION 31 | T. 26 N. R. 14 W. | 16 |
| 3. MISCELLANEOUS PROPERTY IN SECTION..... | T. S. R. E. W. | |
| 4. LOT NO., RECORDED PLAT..... | | |
| 5. PRIVATE CLAIMS..... | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 12, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- D-13 Recovered R.R. Ir. for So. 1/4 Cor., Sec. 32, as monumented by F.Haswell from original evidence, June 1909.
 - E-13 Fd. 1 1/2" pipe in Mon. Box, for Corner Comm. to Sec's. 32&33 on S. line of T26N-R14W. Cor. fits F.Haswell survey of S. line of Sec's. 32&33, dated, June 1909. Cor. falls in B.Top T-rd. intersection, in line with ctr. of rd. to N. & 4'+ N. of ctr. of E-W rd.
 - 16 Recovered 1" pipe, buried in E-W dirt County road, for E 1/8 Cor. on south line of Sec.31 per F. Haswell Survey of Sec.31 in 1909. The E 1/8 Cor.on N. line of Sec.5(25-14) is N89°37'E, 207.93'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

| D-13 | E-13 | 16 |
|---|------------------------------------|--------------------------------|
| Fd. R.R. Ir. (R.R. Rail), vertical, (buried). | Fd. 1 1/2" pipe in Mon. Box | Fd. 1"X36" pipe |
| 6" Cherry N52°E 26.81 | P.Pole S39°W 45.93 | 9" Cherry (cluster) N45°E 49.4 |
| 8" Maple N04°E 39.24 | 8" R.Pine N47°W 61.66 | 12" Maple N10°E 52.4 |
| 7" Maple N20°W 70.60 | NE Cor. S-5(25-14) S89°43'E 296.39 | 5" R.Pine N42°W 57.1 |
| Set Cedar Post w/Loc.Tag | | Old fn.to N. Due W 2'+ |
| Due N 20' | | Ctr.E-W dirt rd. |
| Old fn. line to N. Due E 4.5'+ | | Due N 9'+ |
| Ctr. E-W dirt co. rd. Due S 13'+ | | Set Ced.Post w/Loc. Tag. |
| N 1/4 Cor.S-5(25-14)-S89°40'E-300.07' | | Due N 33' |

SIGNED BY _____ DATE 2-12-79


SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY
MICHIGAN REGISTERED LAND SURVEYOR

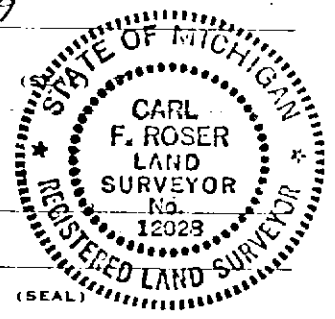

BENZIE COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____