


# LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Benzie (County)	Located In	Corner Code #
1. Public Land Survey	T <u>26N</u> R <u>14W</u>	<u>B-5</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

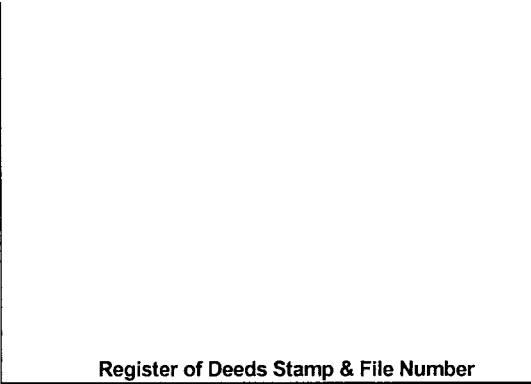

4. Lot No: \_\_\_\_\_ Recorded Plat: \_\_\_\_\_

5. Private Claims: \_\_\_\_\_

I, Craig W. McVean, in a field survey on Sept. 8, 1998 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5	●												
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

- B-5 – GLO – Set 1/4" post – Alvin Burt – 1839  
 Beech 10" S80°E 18L.  
 Beech 14" N69°W 30L.  
 - Geo. Steele – Bk. 1, P. 97 – 1870  
 Established from original BT's  
 - Bk. 2, P. 126 – F. Haswell  
 Set corner from original Wit. & old post

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- B-5 – 1/4 corner common to Sec. 7 & 18 – Fd. 2 1/2" O.D. iron pipe at apparent PI of Gravel Rd. N & E. Fence line to the West. NE 23' to centerline of Gravel Rd. on curve. NW'ly 11.5'± to centerline of road spur. 2 1/2" pipe seems to fit Haswell Survey in Sec. 7 reasonably. 2 1/2" iron pipe accepted as the best available evidence of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- B-5 – 2 1/2" O.D. iron pipe  
 N58°E 51.58' to N & Plas. Tag #13030 in NW side UP  
 N80°W 34.08' to Fd. Nail in S side 22" Cedar  
 S36°E 79.9' to CL. 9" Ash  
 N77°E 77.80' to Fd. nail in S side 7" J. Pine  
 S15°E 133.25' to NW Cor. Blk. FNDDT. HSE #9515



Signed by: Craig W. McVean Date: 8/27/2002  
 Surveyor's Michigan License No.: 39088