

BRANCH COUNTY REMONUMENTATION CORNER

1993

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

COMMISSION

For corners in

BRANCH (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>6S</u> R <u>6W</u>	<u>K-9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

260

REC'D FOR RECORD  
STATE OF MICHIGAN  
BRANCH COUNTY

93 DEC 27 AM 10:0

REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Edward W. Reed in a field survey on November 2, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

SECTION CORNER COMMON TO SECTIONS 23-24-25-26

1829: W. Brookfield, GLO Dept. Surveyor. Set Section post. B. Oak 20", S48E 173; W. Oak 10", N53W 158

1976 E. R. Reed, County Surveyor. Iron stake. Brick Corner post, S43E 40.75'; SE corner cement abutment, N16W 40.9.

- David R. Greer, ANR Pipeline Co, Surveyor. Iron Stake. SW cor. Brick cor. post, S43E 41.50'; SE cor. Cement abutment, N16W 41.50'; NE cor. House N88W 102.63'; SW cor. House, S40E 145.48'.

B. 1990 E.W. Reed, Surveyor, Found Iron stake using witness of E.R. Reed, 1976 survey.  
Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found iron rod as described in witness of E.R. Reed; David R. Greer & E.W. Reed.


Set ½" x 18" Rebar iron with I.D. cap in CI monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Rebar iron stake as noted above:

- S 22 W 85.50', Power Pole
- S 43 E 41.50', SW cor. Brick corner post
- N 16 W 40.99, SE cor. Cement abutment
- N 88 W 102.63', NE cor. house # 280
- S 40 E 145.48', SW cor. house # 297

And is accepted as a careful and faithful perpetuation of the position of the original corner.

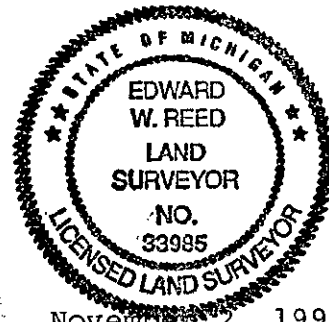

Signed by Edward W. Reed

Date November 2, 1993

Surveyor's Michigan License No. 33985