

BRANCH COUNTY REMONUMENTATION CORNER STATE OF MICHIGAN
LAND CORNER RECORDATION CERTIFICATE Branch County
 Filing Requirement of Act 74, Mich. P.A. 1970 Recorded

SECTION

For corners in

<u>BRANCH</u> (County)	Located In:	Corner Code =#
KINDERHOOK TOWNSHIP	T 8 S R 6 W	H - 07
1. Public Land Survey	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

11-08-1999 15:15:14

Linda Lee Morrison-Mathews
REGISTER OF DEEDS

Liber 00004 Page 0035

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Edward R. Reed, in a field survey on August 9, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

H - 07: QUARTER CORNER TO SECTIONS 15 & 22, KINDERHOOK TWP., T8S, R6W.

G.L.O. - Robert Clark, Jr., D.S., 1828: "Set stake".

J. H. Bennett, 1889: "Fd. roots of both US trees, set stake & stone."

John J. Cox, Co. Surveyor, 1911: "Fd. old stake in stones. Set in place of stake 1" gaspipe 4 ft. long."

D. Hooth, MSHD, 1963: "Fd. 3/4" iron pipe." (took witnesses.)

D. Andrews, P.S., 1999: "Fd 1" pipe with stone S&E. Wit: 20" Maple S30E 9.33'; 10" Hickory, S70W 35.81'; 20" Oak, S70W 43.78'; 24" Beech, S. 33.7'; 36" DbL. Oak, North 90.90'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

From witnesses of D. Andrews, found the 1" pipe surrounded by stone, at ground surface, with recent flagging around the pipe.

Set a 1/2" x 24" rebar, with a Branch County Remonumentation Cap on to of rebar, in the pipe.

Placed a Carsonite Survey Marker post a north side of monument and stones.

AND IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

REMONUMENTATION CAP ON 1/2" REBAR, IN 1" PIPE:

20" MAPLE, S30E 9.33'

10" HICKORY, S70W 35.81'

20" OAK, S70W 43.78'


24" BEECH, SOUTH 33.7'

36" DOUBLE OAK, NORTH 90.90'


APPROX. 132' WEST OF A NORTH-SOUTH FENCELINE (WITH LANES BOTH SIDES).

APPROX. 188' SOUTH OF SHORE OF LAKE.

ALL REFERENCES TO TREES ARE TO CENTER OF TREE (AND SPIKE).

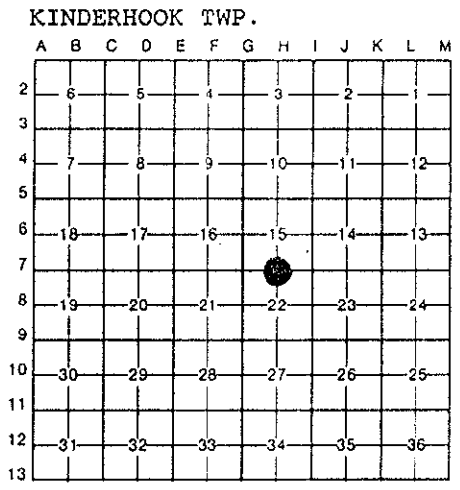

ACCEPTED BY THE BRANCH COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON Oct. 2, 1999
E.R. Reed, Co. Rep.
 E.R. REED

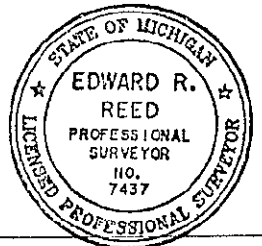

Signed by *Edward R. Reed* Edward R. Reed, P.S. Date August 9, 1999
 Surveyor's Michigan License No. 7437