

**SURVEY &  
REMONUMENTATION**

MAR 21 1997

**COMMISSION**

CALHOUN COUNTY REMONUMENTATION  
**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
CALHOUN COUNTY  
RECORDED

24 JUL 96 2:03 P.M.

ANNE B. ADLANDER  
CLERK - REGISTER OF DEEDS

**Register of Deeds Stamp & File Number**

**APPROVED**  
date July 17 1996  
**CALHOUN COUNTY  
REMONUMENTATION.**

For corners in

Calhoun <small>(County)</small> Emmett Township	Located In:	Corner Code #
1. Public Land Survey	T <u>2S</u> R <u>7W</u>	G-4
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

William K. Crane, in a field survey on June 6, 1996,  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned  
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the  
current manual of survey instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5  
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a  
Court of Law; established, re-established, monumented, re-monumented, recovered, found as  
expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded  
on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

Original survey by Sylvester  
Sibley, Deputy Surveyor

Resurvey by Hodgeman (1889)  
Set 3"x3' tile midway in the  
East line of Section 9.

1960 Survey by P.  
Rosendale

11' White Oak S 14° E 120 links  
28" DO N 52° W 11 links

Witnesses:

In line with N&S fence  
Fence line West, South 27 links  
20" Yellow Oak N 2° E 1.155 chains

Set nail between con-  
crete monuments 66'  
apart.  
12" Box Elder South  
36.40'  
10" Catalpa S 22°  
55.02'  
20" Cherry N 110°  
20.96'

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

Found concrete monument at Northeast corner of Plat of Eastdale (Liber 5, on page 21)  
and iron 231 feet North of monument on section line. From 1973 survey by Dekeyser &  
Associates. Computed corner location excavated and found nothing. Set corner 17 feet  
South of monument on line with iron and monument.


LIBER 1876 PAGE 201

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Set Standard Calhoun County Remonumentation Monument (Bernsten Monument) and monument box at  
point as described above.

Witnesses:

Concrete monument, North 17.00'  
Centerline of road, East & West, South 4.5'  
Southwest corner of house foundation # 1143 N 20° E 70.34'  
Northwest corner of brick face house # 1142 S 20° E 85.39'  
Nail & Cap, North side of power pole S 60° E 88.21'  
Nail & Cap, South side 15" Oak N 70° W 56.60'

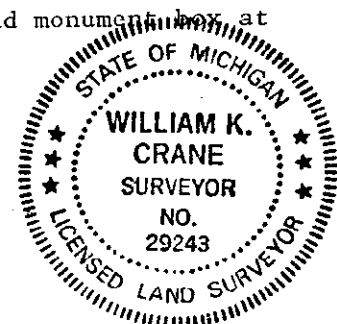

Signed by William K. Crane  
William K. Crane # 29243  
Surveyor's Michigan License No. \_\_\_\_\_

Date July 17, 1996