

MAR 30 1999

APPROVED

Date 7-15-98 *RAC*

**CALHOUN COUNTY
REMONUMENTATION.**

**CALHOUN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

STATE OF MICHIGAN
CALHOUN COUNTY
RECORDED

20 JUL 1998 1:53:42 PM

For corners in

Calhoun _____	Located In:	Corner Code #
(County)		
CLARENDON		
1. Public Land Survey	T <u>4S</u> R <u>5W</u>	<u>E-2</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

ANNE B. NORLANDER
CLERK - REGISTER OF DEEDS
LIBER **2044** PAGE **155**

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Michael A. Groat, in a field survey on November, 1997, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5	4			3		2			1
3													
4	7					9		10		11			12
5													
6	18			17		16		15		14			13
7													
8	19			20		21		22		23			24
9													
10	30			29		28		27		26			25
11													
12	31			32		33		34		35			36
13													

A. Description of original monument and accessories and/or subsequent restoration:
Original Survey by Robert Clark Jr., Deputy Surveyor, set post, 6" Hickory, N 52° W, 8 1/2 LKS, 8" Sugar Maple, S 69° E, 8 LKS Courtwright, 18-, Angular Sandstone. 8" Y. Oak, N 72° W, 37 1/2 LKS 12" B. Oak S 61° W, 89 1/2 LKS.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
We found a large angular stone, (not a sandstone) at the occupied corner location, Traversing from the northwest to southwest corners of the section & pro-rating the distance, the south 1/2 mile would measure 2650.02. The stone to the southwest corner measures 2651.20 and 1.0' west of line. Excavating around the stone we found several smaller rocks.
Accepted the location of the angular stone as the best perpetuation of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Set a Bemtsen monument with a carsonite marker on the west side. Stamped the corner code information in the brass cap.
Nail & Tag in N'ly side of 7" Oak, 291° NAZ, 24.74'
Nail & Tag in E'ly side of 8" Maple, 2° NAZ, 18.54'
Nail & Tag in N'ly side of 24" Oak, 129° NAZ, 5.86'
Nail & Tag in N'ly side of 12" Elm, 188° NAZ, 14.45'
Nail & Tag in S'ly side of 24" Oak, East, 11.45'

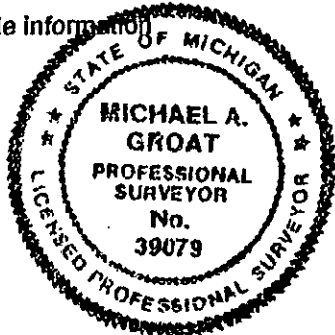

NAZ = Magnetic Azimuth measured from North.
Signed by [Signature]
Surveyor's Michigan License No. 39079

Date May 21, 1998