

CALHOUN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

APPROVED
 Date Oct. 18 1995
 CALHOUN COUNTY
 REMONUMENTATION.

For corners in Calhoun (County) Located In: _____ Corner Code # _____

1. Public Land Survey	T <u>4</u> S. R <u>7</u> W.	<u>L-11</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

STATE OF MICHIGAN
 CALHOUN COUNTY
 RECORDED
 26 OCT 95 10:00 A.M.
Register of Deeds Stamp & File Number

CLERK - REGISTER OF DEEDS
 Burlington

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Michael A. Groat, in a field survey on July 3, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- | | |
|------------------------------------|------------------------------------|
| <u>Lyon 1826</u> | <u>Courtright, 1893</u> |
| <u>7" Ash S 86° W 13 1/2 links</u> | <u>3" tile 3' long</u> |
| <u>30" Elm, N 44° E 28 links</u> | <u>16" Oak, S 41° W 50 feet</u> |
| | <u>6" Maple, S 21° E 45.5 feet</u> |

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- Corner falls over drain running under road.
No evidence was found of existing corner.
Traversed between Southeast and Southwest corners of Section 25 and set monument mid way on line.


COMMISSION
 REMONUMENTATION

LIBER **1828** PAGE **36**

FEB 22 1996

COMMISSION

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Set Harrison monument, from which:
Set nail and spotter in 12" Cherry, S 15° W, 39.3'
Set nail and spotter in 12" Maple, N 70° W, 37.0'
Set nail and spotter in 12" Oak, North 25.9'
Set nail and spotter in 24" twin Oak, S 50° E, 45.6'

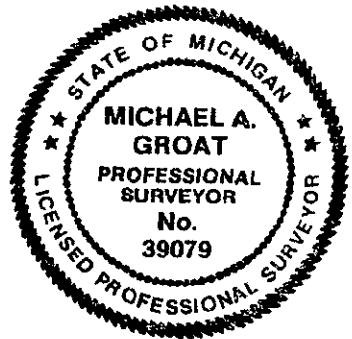

Signed by Michael A. Groat
 Surveyor's Michigan License No. 39079

Date 10-16-95