

**Cass County Remonumentation Program  
LAND CORNER RECORDATION CERTIFICATE**

**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in E ¼ Post Section 13, Ontwa Twp.

<u>Cass</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>8S</u> R <u>15W</u>	<u>M - 6</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

STATE OF MICHIGAN  
COUNTY OF CASS  
Recorded

12-22-1999 12:51:09

Ann L. Simmons  
REGISTER OF DEEDS

Register of Deeds Stamp & File  
Number

Ratified by Peer Group  
In Accordance With P.A. 345  
Chairman Bob C. [Signature]  
Date Dec. 7, 1999

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4			3		2		1
3													
4	7			8		9			10		11		12
5													
6	16			17		16			15		14		13
7													
8	19			20		21			22		23		24
9													
10	30			29		28			27		26		25
11													
12	31			32		33			34		35		36
13													

I, Daniel B. Zwar, in a field survey on Dec. 13,  
19 99, do hereby state that under requirements of P.A. 74, Michigan P.A. of  
1970, the corner points mentioned in lines 1 and 2 above were in conformance  
with regulations and rules therefore as required in the current manual of survey  
instructions of the United States Department of the Interior, Bureau of Land  
Management or by a decree of a Court of Law and /or that the corner points  
mentioned in lines 3, 4 and 5 above were in conformance with the rules of the  
Michigan Board of Land Surveyors or by a Decree of a Court of Law; established,  
re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded  
on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

1827 - W.M. Brookfield - Set ¼ post, 4" Hickory N 78° W 90 lks; 4" W Oak S 23 ¼ W 50 lks.

No other history found.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1999 - D.B. Zwar - Found very bent ¾ pipe in lots of rocks - Was able to determine original pipe location & held that. Found no other  
evidence except brush/field line to West.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1999 - D.B. Zwar - Placed standard Cass remon concrete monument to pipe location surrounded by rocks below ground.


Witnesses: West ¼ post Section 18, Mason Twp. South 206.73'  
PK in 12" Cherry S 10° E 222.27';  
15" Oak S 01° E 225.40';  
NE corner Sec 13 North 2642.32';  
SE corner Section 13 South 2650.75'.

This location is accepted as the best available evidence of the position of the original corner.

Signed by Daniel B. Zwar

Date Dec 22, 1999

Surveyor's Michigan License No. 28435

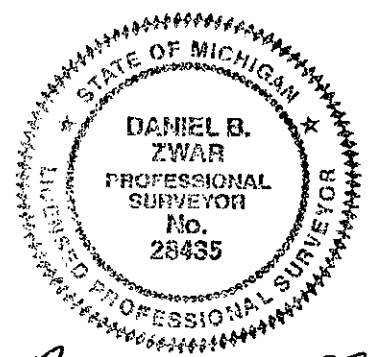

FEB 24 2000

SECTION