

STATE OF MICHIGAN  
DEPARTMENT  
OF  
NATURAL RESOURCES

LAND CORNER RECORD

Chippewa COUNTY


T 42N R 2-3E

DESCRIPTION OF CORNER Sec. Cor. common to Secs. 30-31-25-36

CORNER MONUMENT 1" pipe with 4" aluminum cap

DATE MONUMENT PLACED AND WITNESSED 10-27-71

WITNESSES TO CORNER..... 12" Cedar (S31 NBT) S32°E 46.5'

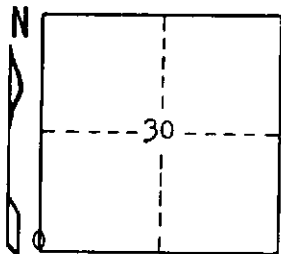

18" Cedar stub (S30 NBT) N63°E 58.4'

AND

CIRCLE CORNER REGISTERED

DESCRIPTION IN DETAIL AS TO HOW CORNER WAS LOCATED AND IDENTIFIED OR RESTORED.

This corner replaced at a squared cedar tree which agrees with a probable W. Pine line tree to north, 492.' Record distance= 494.3' Location checks for record distance to stream east; stream and swamp edges to north; stream and swamp edge to west. Found very old blazes to north, east and south.

Believe this corner to be replaced in the original position, tho we could not positively indentify the original cedar or tamarack witnesses.

SURVEYOR'S SEAL

SIGNED

*Billy D. Buckler*

Billy D. Buckler  
REGISTERED LAND SURVEYOR

DATE 12-7-71

DISTRIBUTION:

County Courthouse  
Area Forester (Regions I & II)  
District or Region Surveyor  
Forestry Div., Lansing *e*