

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

CHIPPEWA CO.

2 CORNERS

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>41</u> N., R. <u>6</u> E.	B-5
2. PROPERTY CONTROLLING IN SECTION	T. <u>41</u> N., R. <u>6</u> E.	1
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N., R. _____ E. S., R. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND  
FILING NUMBER

I, Gerald L. Wiggins, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-23, 1988, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- B-5 North 1/4 Corner for Section 18. *OBT'S: Aspen 6, S86°W, 24 lks. & Willow 4, N78°E, 7 lks.*
- 1 West 1/16 Corner on north side of Section 18. *Not previously set.*

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B-5 Corner set by single proportionate measure between M.C. West side of Pat's Lake and N.W. Corner of Section 18.
- 1 Corner set midpoint on line between N.W. Corner and North 1/4 Corner of Section 18.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
**DNR MONUMENT SET AT BOTH CORNERS.**

B-5 12" Cedar, S38°E, 8.25'	1 12" Cedar, S75°W, 6.9'
12" Cedar, S62°W, 7.6'	10" Cedar, N13°W, 11.2'
10" Cedar, N19°W, 16.5'	10" Cedar, N70°E, 17.0'
10" Cedar, N42°E, 21.35'	6" Cedar, S50°E, 15.8'

SIGNED BY Gerald L. Wiggins DATE 11-22-88

SURVEYOR'S MICHIGAN REGISTRATION NO. 23521


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

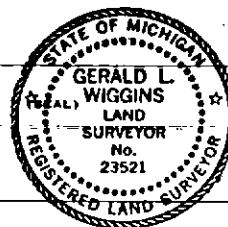

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET