

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970  
CHIPPEWA CO. 3 CORNERS

FOR CORNERS OF:-	LOCATED IN:-	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>41</u> N., R. <u>6</u> E.	<u>B-7, 15, 15</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Gerald L. Wiggins, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-31, 1989, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

- B-7 M.C. West side of Warner Cove between Sections 18 and 19. OBT'S: Set Post and marked a Cedar 6", N53°E, 48 lks.
- 15 M.C. East side of Bay between Sections 18 and 19. OBT'S: Spruce 8", N75°E, 64 lks. & Cedar 6", N53°E, 48 lks.
- 15 M.C. West side of Bay between Sections 18 and 19. OBT'S: Set Post and marked a Cedar 6", N55°W, 31 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B-7 Corner set on South line of Section 18 on West side of Warners Cove, 415.75' West of computed South 1/4 Corner of Section 18.
- 15 Corner set on South line of Section 18 on East side of small bay, 6.99' West of computed West 1/16 Corner on South side of Section 18.
- 15 Corner set on South line of Section 18 on West side of small bay 604.75' West of computed West 1/16 Corner on South side of Section 18.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

DNR Monuments set at all three corners.

B-7 10" Cedar, S4°W, 15.55'	15 14" Cedar, S30°E, 16.3'	15 12" Cedar, North, 17.5'
12" Cedar, S69°W, 28.65'	12" Cedar, South, 6.4'	10" Cedar, N52°W, 10.0'
8" Cedar, N47°W, 4.80'	14" Cedar, N5°W, 15.2'	8" Cedar, S75°W, 25.4'
8" Cedar, N6°E, 9.25'	12" Cedar, S87°E, 17.5'	6" Cedar, S24°W, 8.2'

SIGNED BY Gerald L. Wiggins DATE 6-7-89


SURVEYOR'S MICHIGAN REGISTRATION NO. 23521

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

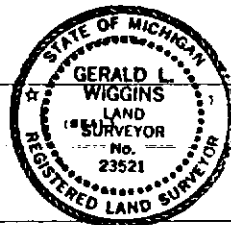

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 26, 1971  
REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET

S&S MICHIGAN DNR