

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

CHIPPEWA CO.

3 CORNERS DRAWING ON BACK

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>41</u> N. R. <u>6</u> E. W.	<u>B-6</u>
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

160  
 870  
 89  
 89  
 89

I, Gerald L. Wiggins, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 5-30, 1989, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:  
**B-6** Center of Section 18. Not previously set. Corner lies in Lake Huron Bay set three witness corners to corner.



B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

1. On North-South 1/4 Line a witness to Center of Section 18, 195' North of Center.
2. On East-West 1/4 Line a witness to Center of Section 18, 187' East of Center.
3. On East-West 1/4 Line a witness to Center of Section 18, 550' West of Center.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 Corner in water no monument set. Placed witness monuments 187' North on E-W 1/4 Line and 550' West on E-W 1/4 Line and 195' North on N-S 1/4 Line.


- |                           |                          |                       |
|---------------------------|--------------------------|-----------------------|
| 1. DNR Monument           | 2. 1" Pipe W/Plastic Cap | 3. DNR Monument       |
| 6" Tamarack, S68°W, 6.75' | 5" Cedar, South, 19.6'   | 6" Cedar, S1°E, 4.7'  |
| 7" Cedar, N83°W, 20.5'    | 12" Cedar, S25°E, 59.1'  | 6" Cedar, S48°W, 6.2' |
| 5" Cedar, N47°W, 23.9'    | 12" Cedar, S62°E, 24.6'  | 6" Cedar, N80°W, 3.0' |
| 6" Cedar, N30°W, 32.7'    | 6" Cedar, N53°E, 6.3'    | 8" Cedar, N22°E, 6.1' |

SIGNED BY Gerald L. Wiggins DATE 6-7-89  
 Gerald L. Wiggins  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 23521

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

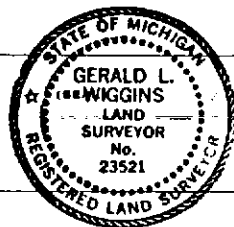

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971  
 REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET