

# LAND CORNER RECORDATION CERTIFICATE

**FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970**

Chippewa Co.

2 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> N. <u>2</u> , R. <u>2</u> E. <u>2</u>	<u>E-5, D-11</u>
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 9-4, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

Corners set by John Mullett, D.S. in 1845, bearings were:

- E-5** Sec. Cor. 8-9-16-17, Sugar 14", N50°W, 30 lks. & Sugar 12", S17°E, 34 lks.
- D-11** Quarter Corner bet. Sec's. 29-32, W. Pine 9", N35°W, 8 lks. & W. Pine 6", S38°W, 5 lks.

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- E-5** Corner re-stored by Double Proportionate Measure, found no evidence of original corner.
- D-11** Corner placed midway and on line between two section corners.


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Placed 1" pipe with 2" aluminium cap at both corners. Bearings are:

- E-5** 8" W. Birch, S28°E, 44.2' and 14" W. Birch, N27°W, 25.0'.
- D-11** 12" R. Pine, N33°W, 29.7' and 14" Spruce, N33°E, 100.9' & 8" W. Birch, N72°E, 70.2'.

SIGNED BY Billy D. Buckler  
 Billy D. Buckler  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 9-21-79

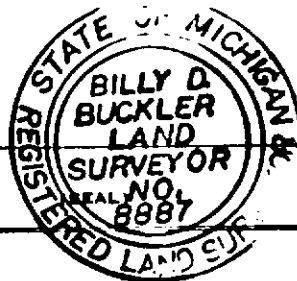

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_