

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

3 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>42</u> ^{N.} / _{S.} R. <u>2</u> ^{E.} / _{W.}	C-12A, C-12B, C-12C
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Luckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-28, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A Description of original monument and accessories and/or subsequent restoration:

- C-12A Section line bet. Sec's. 31-32, on Northerly R.O.W. Line, Hwy M-134.
- C-12B Section line bet. Sec's. 31-32, on Southerly R.O.W. Line, Hwy M-134.
- C-12C Witness to Meander Corner, bet. Sec's. 31-32, on North shore of Lake Huron.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-12A Placed Iron on Sec. line, at 1,520.41' South of 1/4 cor. Sec's. 31-32.
- C-12B Placed a 10" Spike at R.O.W. line. Unable to drive Iron because of Limestone boulders.
- C-12C Placed witness corner, S0° 08' E, 1,932.4' of 1/4 corner bet. Sec's. 31-32, an original corner. Record distance was = 2,178.0'. Line is nearly 400' West of location, indicated on Hwy. Dep't. Plan, Project # 17-29.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- C-12A Placed 36" T-Iron on R.O.W. line. Bearings: 6" Cedar, N27°W, 38.3' & Power Pole (GT4 16: N25°W, 2.2'. & 13" W. Pine, S85°E, 44.5'.
- C-12B Placed 10" Spike, at R.O.W. line. Bearings: 5" Cedar, S3°E, 17.2' & 4" Cedar, S85°E, 18.5'. & R.O.W. Monument, S60°E, 75.5'
- C-12C Placed 3/4" Square Iron, 18" long as witness. New Bearings: Chiseled Cross, on West end of Limestone Boulder, N77°E, 25.9' and marked 8" Cedar, N20°E, 120.8'.

SIGNED BY Billy D. Luckler

 EILLY D. LUCKLER
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

DATE 7-31-81

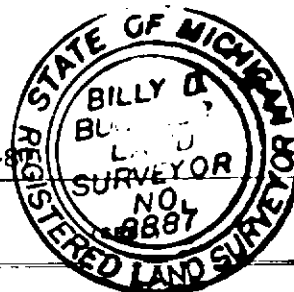

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____