

**SURVEY & REMONUMENTATION**

CHIPPEWA COUNTY REMONUMENTATION CORNER

APR 26 1995

**COMMISSION**

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Chippewa

(County)

Located In:

Corner Code ~~≠~~

1. Public Land Survey	T <u>44N</u> R <u>1W</u>	<u>B-1</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

\$ 7.00 LAND CORNER  
\$ 2.00 MSSR  
24 OCT 94 3:44 P.M. RECEIPT# 031  
RECEIVED FOR RECORD  
CHIPPEWA COUNTY - STATE OF MICHIGAN  
SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Keith R. Waters, in a field survey on June 20, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

B-1 North 1/4 Corner of Section 6, T44N, R1W

Corner was not set in the original survey. Found no evidence of subsequent establishment.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-1 (T44N, R1W)

This corner is being established as part of the Chippewa County Remonumentation Program.

Established corner at proportionate distance according to original GLO notes on township line between township corner to the west and closing corner common to Sections 5 & 6, T44N, R1W to the east. Corner falls 17.16 feet east of the south 1/4 corner of Section 31, T45N, R1W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


B-1 (T44N, R1W)

Corner is a 3/4" x 24" rebar with 3 1/4" aluminum Chippewa County Remonumentation cap. Witnesses:

- 6" Red Maple, S62°W 47.04'
- 10" Red Pine, N43°W 27.58'
- 9" Spruce, N64°W 10.98'
- 5" Spruce, S07°E 8.93'

Concrete Monument (S 1/4 Corner of Section 31), WEST 17.16'

Note: Distances are to a nail and tag in the side of the witness object. Trees are blazed and painted. Bearings are compass bearings corrected for declination.

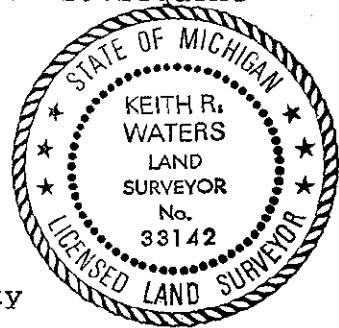

Signed by Keith R. Waters

Date 10-18-94

Surveyor's Michigan License No. 33142

