

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Chippewa County Remonumentation Corner

For corners in

Chippewa County Located in: Corner Code #

1. Public Land Survey T44N R1W I-4
T R
T R
T R
T R

2. Property Controlling in Section S T
S T
S T

3. Miscellaneous Property in Sec. S T

4. Lot No. , Recorded Plat

5. Private Claims

**SURVEY &
REMONUMENTATION**
FEB 23 2001

SECTION

BOOK **11** PAGE **183**

\$7.00 LAND CORNER

\$2.00 MSSR

2 FEB 2001 3:46:58 PM Receipt #1103

RECEIVED FOR RECORD
CHIPPewa COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on November 10, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-4 1/4 Corner Common to Sections 10 & 11, T44N, R1W.

1845 – Original corner established by James H. Mullett.

Witnesses: Hemlock 30, N41°W 13 links – Hemlock 12, S70°E 32 links.

1962 – Billy D. Buckler, RLS 8887, Michigan Department of Conservation Land Corner Record, Liber 3, page 140, Chippewa County corner records. Corner reestablished midway on line between two section corners in line with old dead furrow to West, 1/2 chain East of road. 1" pipe with aluminum cap. Witnessed by 7" Soft Maple (1/4 S NBT), S52°W 171 1/2 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program. Found a 1" pipe with an aluminum DNR cap as called for in the above mentioned 1962 records. Also found what appears to be the record red maple bearing tree. The distance to the tree differs from the DNR records by approximately 20 feet. However, measurements to other corners north and south confirm that the monument is in the position as established by Mr. Buckler. Accepted corner as found and established additional witness objects.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found a 1" pipe with an aluminum DNR cap at the corner location, which falls 30± east of a north-south road, in line with an old fence to the west.

Witnesses:


Nail and plastic witness tag #22428 in 12" Red Pine, N08°E 35.75'

Nail and plastic witness tag #22428 in Jack Pine, S80°E 9.28'

Nail and plastic witness tag #33142 in 11" Red Maple in clump, S47°W 93.28'

Nail and plastic witness tag #33142 in 10" Twin Red Pine, N52°W 68.60'

1/2" Iron with cap #22428, WEST 43.39'

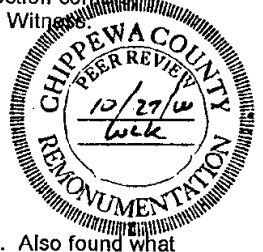

Signed by Keith R. Waters

Date 12-29-00

Surveyor's Michigan License No. 33142

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISIED MAY 14, 1975
REVISIED JAN., 1983
REVISIED OCT., 1995