

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

4 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>44</u> N. <u>6</u> W.	K-11, L-11, J-11, J-12
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 2-6 & 1-27, 1981, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Section and quarter corners set by H. Brevoort Jr., D.S. in 1845. Bearings were:

- K-11 Sec. Cor. 25-26-35-36. Spruce 6", S64°E, 25 lks. & Spruce 8", S14°W, 41 lks.
- L-11 Quarter Corner bet. Sec's. 25-36. Spruce 14", S39°E, 16 lks. & Aspen 6", N37°W, 13 lks.
- J-11 Quarter Corner bet. Sec's. 26-35. Beech 6", N54°E, 04 lks. & Beech 8", S34°E, 26 lks.
- J-12 Center Corner of Section 35.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- K-11 Found 1" iron in place at sec. cor. Location tied into a recorded plat.
- L-11 Re-established cor. midway and on line bet. two sec. cors. No evidence found.
- J-11 Re-established cor. midway and on line bet. two sec. cors. No evidence found.
- J-12 Placed cor. at intersection of strait lines connecting opposite quarter corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners. New bearings:

- K-11 6" W. Pine, N42°E, 14.5' & 6" Tamarack, N16°E, 88.0' & 6" Tam., West, 17.0'.
- L-11 6" Cedar, N11°E, 25.8' & 24" W. Pine, N32°W, 49.0' & 8" R. Maple, S35°W, 14.1'.
- J-11 8" H. Maple, S60°E, 11.3' & 10" R. Maple, N79°W, 25.6' & 20" Hemlock, S44°W, 75.5'.
- J-12 5" R. Pine, S81°E, 57.9' & 6" R. Pine, N8°E, 26.5'.

SIGNED BY Billy D. Buckler DATE 2-11-81
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

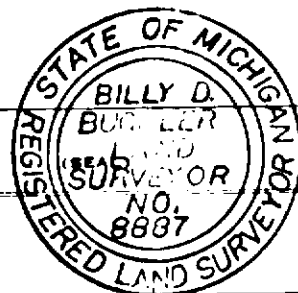

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____