

MAR 09 1994

## Chippewa County Remonumentation Corner

RECEIVED FOR RECORD

COMMISSION

\_\_\_\_\_ , Recorded Plat

5. Private Claims \_


## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

93 DEC 29 PM 2: 50

Chippewa		Located In:	Lagated In-	Corner Code <i>⊒4</i>	J. Kepen Malsik
	(County)	<del></del>	Located III,	Comer Code 44	REGISTER OF DEEDS
1.	Public Land Survey		T44N R 2E	J-13	
			T R		
			T R		
			T R		
2.	Property Controlling	s	T R		
	in Section	S	T R		
3.	Miscellaneous	- S	T R		Register of Deeds Stamp & File Number
	Property in Sec.	s	T R		giotoi o becas ottantp a i ne rembi

I, William L. Karr , in a field survey on December 8 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

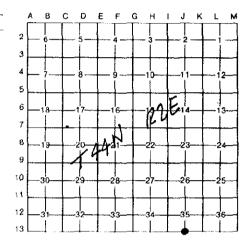

A. Description of original monument and accessories and/or subsequent restoration:

South 1/4 Corner of Section 35 (T44N-R2E)

Neal Sperhake, L.S. 7876 (Kimberly Clark Corp.) Witness Corner recorded in Liber 3, Page 109 of the Chippewa County Corner Records. Found iron rod for the corner. Set a 1" pipe with stamped aluminum cap as a Witness Corner 33' South. Witnessed the Witness Corner.

Ronald R. Bischer, L.S. 22428, recorded in Liber 1, Page 347 of the Chippewa County Corner Records. Replaced corner with a ½" rod from "1971 Porter Survey"
Kimberly Clark Monument North 33.00' Kimberly Clark Monument

9" Cedar

N12°E

53.03' (old witness) 57.06' (old witness)

16" Cedar

N34°E

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found a bent ½" iron, 8" below paved road surface. Found record witness monument to the North. Found the recorded bearing trees as recorded by Bischer. Nail with L.S. 15410 tag in side of each tree. Distance from the iron to the witnesses checked well. Straightened iron. Accepted corner position as found and offset it prior to well well. Replaced corner after construction completed. Added three of road reconstruction. additional witnesses. Placed nail and tag above nail in 16" Cedar.

C. Description of monument for corner and accessories established to perpetuate locating the position of the cornér: (J-13) Corner is a 3/4" x 24" iron with plastic "Chippewa County Remonumentation" cap. Corner falls 1' South of the centerline of Gogomain Road (East-West, paved). Witnesses:

14" O.D. pipe w/ Stamped Aluminum Cap North 32.79' (existing) 53.42' (existing nail & L.S.15410, tag) 10" Cedar NO6°E 16" Cedar N28°E 57.12' (existing - new nail # S24°E 52.72' S51°W 53.497

14" O.D. Pipe w/ Stamped Aluminum Cap (Witness Monument to North 1/4 Sec. 2) Railroad Spike Set in Boulder N38°W

33.10' (Common Witness) West 47.52

Date ...

tag)WILLIAM L

KARR

LAND

SURVEYOR

Signed by \_\_\_\_\_\_

North 4 Corner of Section 2

27450

Surveyor's Michigan License No. 27450

NOTE: Bearings are compass bearings corrected for declination. Approved by Michigan State Board of Land Surveyors, Jan. 28, 1971

REVISED MAY 14, 1975 Distances are to a nail in side of witness objects unless noted.