

**CHIPPEWA COUNTY REMONUMENTATION CORNER**

MAR 27 1996

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **CHIPPEWA COUNTY**

Chippewa (County)	Located In:	Corner Code #
1. Public Land Survey	T 44N R 2W T 43N R 2W T _____ R _____ T _____ R _____	<u>D-13</u> Same D-1 Corner
2. Property Controlling in Section	S _____ T _____ R _____ S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____ S _____ T _____ R _____	_____

\$ 7.00 LAND CORNER  
\$ 2.00 MSSR  
28 FEB 96 4:32 P.M. RECEIPT# 459  
RECEIVED FOR RECORD  
CHIPPEWA COUNTY - STATE OF MICHIGAN  
SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Keith R. Waters, in a field survey on 12/19, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

**A. Description of original monument and accessories and/or subsequent restoration:**

D-13 1/4 Corner Common to Section 5, T43N, R2W & Section 32, T44N, R2W  
1840 - Original ties (William A. Burt): Fir 8, N25°E 16 links - Spruce 10, N19°W 19 links.  
1989 - Richard L. Hays, P.S. 25847, as recorded in D-24, Mackinac County recorded corners. Corner was established by single proportionate measurement between recovered corners at the S.W. corner of Section 31 and the S.E. corner of Section 32, T44N, R2W.  
1993 - David B. Guthrie, P.S. 22435, Mackinac County Remonumentation Surveyor, as recorded in D-193, Mackinac County recorded corners. Found 2 1/2" x 3" monument with 3" aluminum cap. Witnesses: 4" Spruce, N45°W 8.75' - 6" Spruce, N13°E 29.55' - 4" Aspen, S44°E 16.71' - 6" Aspen, S23°W 14.71' - Iron Post, WEST 1.05'


**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.  
Found a 2 1/2" x 3" monument with a 3" aluminum cap stamped to identify the corner. Also found witness objects as called for in Mackinac County LCRC.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Corner is a 2 1/2" x 3" monument with a stamped 3" aluminum cap. Witnesses:

4" Spruce, N45°W 8.75' Note: Trees are blazed, painted and tagged.  
6" Spruce, N13°E 29.55'  
4" Aspen, S44°E 16.71'  
6" Aspen, S23°W 14.71'  
Iron Post, WEST 1.05'

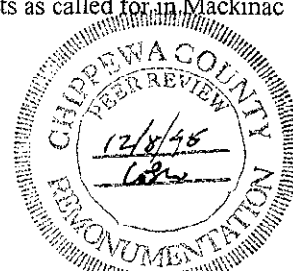

Signed by Keith R. Waters  
Surveyor's Michigan License No. 33142

Date December 29, 1995