

CHIPPEWA COUNTY REMONUMENTATION CORNER

MAR 27 1996

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in COMMISSION

Chippewa

(County)

Located In:

Corner Code #

1. Public Land Survey

T44N R 2W

F-13 Same
F-1 Corner

T43N R 2W

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

\$ 7.00 LAND CORNER

\$ 2.00 HSSR

28 FEB 96 4:33 P.M. RECEIPT# 459

RECEIVED FOR RECORD

CHIPPEWA COUNTY - STATE OF MICHIGAN

SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Keith R. Waters

12/19 95

I, _____, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4			3		2		1
3													
4	7				8		9		10		11		12
5													
6	18			17		16		15		14		13	
7													
8	19			20		21		22		23		24	
9													
10	30			29		28		27		26		25	
11													
12	31			32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

F-13 1/4 Corner Common to Section 4, T43N, R2W & Section 33, T44N, R2W

1840 - Original ties (William A. Burt): Fir 7, N10°E 05 links - Aspen 13, N80°W 18 links.

Date Unknown - MDOT R.O.W. map for I-75 (Chippewa County): 1/4 Corner is 27.59' West of Survey Centerline, Station 149+39.12.

Date Unknown - MDOT R.O.W. map for I-75 (Mackinac County): 1/4 Corner is 62.59' West of N'bd Survey line, Station 1294+37.08.

1988 - Richard L. Hays, P.S. 25847, Mackinac County recorded corner D-38. Corner was established by single proportionate measurement between recovered corners at the S.W. corner of Section 33 and the S.E. corner of Section 33, T44N, R2W.

1993 - David B. Guthrie, P.S. 22435, Mackinac County recorded corner D-194. Found monument as recorded in D-38 above.

1995 - Gary Koepke, P.S. 26458, MDOT land corner notes. Found corner as recorded in D-38 and D-194.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found a 2 1/2" x 3" monument with a 3" aluminum cap stamped to identify the corner as called for in Mackinac County LCRC's D-38, D-194, and MDOT corner notes. Gary Koepke's notes indicate that the origin of the ties as shown on the Chippewa and Mackinac County right-of-way maps is unknown and that the location as shown on said maps is questionable. He also indicates that a search was performed at the location indicated on right-of-way maps and that nothing was found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 2 1/2" x 3" monument with a stamped aluminum cap in the median of I-75. Witnesses:

10" Spruce Stub, S89°E 201.96' (Nail and tag)


15" Spruce, N86°W 193.38' (Nail and tag)

Steel Post, EAST 1.21'

"+" in Stencil Station 1293+00, N40°W 38.19'

"+" in Stencil Station 1292+00, N25°W 74.14'

(Pavement stencils are in east edge of southbound lane of I-75)

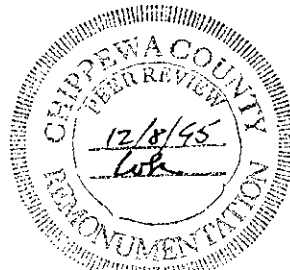

Signed by Keith R. Waters

Date December 29, 1995

Surveyor's Michigan License No. 33142