

SURVEY & REMONUMENTATION

MAY 28 1997 CHIPPEWA COUNTY REMONUMENTATION CORNER

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Chippewa (County)	Located In:	Corner Code #
1. Public Land Survey	T44N R 5W	G-10
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

\$7.00 LAND CORNER

\$2.00 HSSR

2/28/1997 4:07:50 PM Receipt #226
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 9 PAGE 388

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____


I, Keith R. Waters, in a field survey on 09/09, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

G-10 1/4 Corner Common to Sections 27 & 28, Town 44 North, Range 5 West
1849 - Original ties (Harvey Mullen): Cedar 5, N70°E 07 links - Cedar 7, S23°W W 09 links.
1937 - United States Department of Interior, General Land Office, Dependent Resurvey, Oscar Walsh, surveyor.
Re-established corner by proportionate measurement. Set a 2" x 36" iron post.
Witnesses: 8" Cedar, S55°E 21½ links - 5" Cedar, N26°W 22 links.

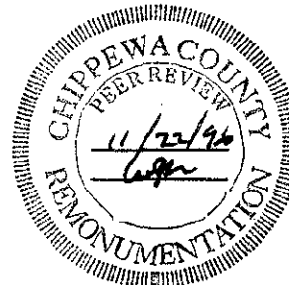

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.
Found an iron pipe with a brass GLO cap as called for in above mentioned 1937 dependent resurvey. Found no evidence of the previous bearing trees. Accepted corner as found and established new bearing trees.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is an iron pipe with a brass GLO cap.
Witnesses:
7" Cedar, S59°W 10.03'
8" Cedar, N09°E 7.92'
5" Cedar, S75°W 11.74'
5" Cedar, S50°E 4.03'



Note: Unless noted otherwise, distances are to a nail/tag #33142 in the side of the witness object. Bearings are compass bearings corrected for declination. Trees are blazed and painted.

Signed by Keith R. Waters
Surveyor's Michigan License No. 33142

Date 12-30-96