

**SURVEY & REMONUMENTATION CHIPPEWA COUNTY REMONUMENTATION CORNER**

APR 26 1995

**LAND CORNER RECORDATION CERTIFICATE**

Filing Requirement of Act 74, Mich. P.A. 1970

For corner COMMISSION  
Chippewa

	Located In:	Corner Code #
1. Public Land Survey	T <u>45N</u> R <u>1W</u>	<u>I-10</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

\$ 7.00 LAND CORNER  
\$ 2.00 MSSR  
19 JAN 95 4:16 P.M. RECEIPT# 2266  
RECEIVED FOR RECORD  
CHIPPEWA COUNTY - STATE OF MICHIGAN  
SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

Keith R. Waters October 31 94

I, Keith R. Waters in a field survey on October 31, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-10 1/4 Corner Common to Sections 26 & 27, T45N, R1W.

Original ties to post: Fir 6, N79°E 14 links Hemlock 20, S79°W 10 links.  
1978 - As recorded in liber 1, page 300, Chippewa County corner records, by Billy Buckler, RLS 8887. Set 1" pipe and 4" aluminum cap mid-way on line between section corners 2645.4 feet north and south. Witnesses:  
10" Cedar, S40°E 46.0' 8" Maple, S58°W 8.65' 6" Cedar, N27°E 8.2'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-10 (T45N, R1W)

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found a 1" iron pipe with a 4" aluminum DNR cap and all three bearing trees as called for in liber 1, page 300. Accepted corner as found and established an additional bearing tree.




C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-10 (T45N, R1W)

Corner is a 1" iron pipe with a 4" aluminum DNR cap. Witnesses:

- 11" Maple, S58°W 8.90'
- 7" Cedar, N27°E 8.25'
- 11" Cedar, S40°E 46.36'
- 8" Cedar, SOUTH 28.20'

Note: Distances are to a nail and tag in the side of the tree. Trees are blazed and painted. Bearings are compass bearings corrected for declination.

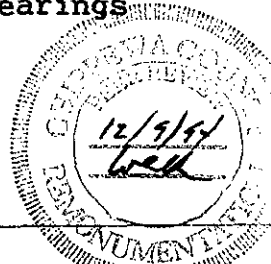

Signed by Keith R. Waters

Date 12-23-94

Surveyor's Michigan License No. 33142