

SURVEY & REMONUMENTATION CHIPPEWA COUNTY REMONUMENTATION CORNER


APR 26 1995

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Chippewa
COMMISSION
(County)

Located In: Corner Code #

- | | | | | | |
|---------------------------------------|---|-----|---|----|-----|
| 1. Public Land Survey | T | 45N | R | 1W | K-8 |
| | T | | R | | |
| | T | | R | | |
| | T | | R | | |
| 2. Property Controlling in Section | S | | T | R | |
| | S | | T | R | |
| 3. Miscellaneous Property in Sec. | S | | T | R | |
| | S | | T | R | |
| 4. Lot No. _____, Recorded Plat _____ | | | | | |
| 5. Private Claims _____ | | | | | |

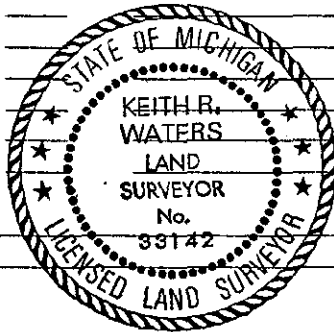

\$ 7.00 LAND CORNER
\$ 2.00 MSSR
19 JAN 95 4:17 P.M. RECEIPT# 2266
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Keith R. Waters in a field survey on December 12, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therofore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-8 1/4 Corner Common to Sections 23 & 24, T45N, R1W.

Original ties to post: Birch 10, S56°E 06 links Hemlock 8, S62°W 21 links.
1986 - Corner is shown on a survey by Earl Strater, P.S. 28424. Set 1/2" iron pin. Witnesses: 30" Hemlock, N65°W 13.79' 30" Hemlock, S70°E 11.23' 16" Red Maple, S28°W 15.00'. Corner set mid-way on line between section corners 2678.94 feet north and 2678.94 feet south.
1989 - Corner is shown on a survey by William Karr, P.S. 27450. Found 1/2" iron with record ties same as shown above by Earl Strater.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


K-8 (T45N, R1W)
This corner is being perpetuated as part of the Chippewa County Remonumentation Program.
Found a 1/2" iron with a plastic cap #28424 and all three bearing trees as shown on above mentioned certificate of surveys. The dimensions of the sections in this area are very inconsistent with both GLO and County Surveyor notes. Corner position has been used for several surveys in section 24. Accepted corner as found and established an additional bearing tree.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-8 (T45N, R1W)
Corner is a 1/2" iron with plastic cap #28424. Witnesses:

- 30" Hemlock, N65°W 13.77'
- 30" Hemlock, S70°E 11.20'
- 20" Red Maple, S28°W 14.98'
- 7" Red Maple, N14°E 12.76'

Note: Distances are to a nail and tag in the side of the tree. Trees are blazed and painted. Bearings are compass bearings corrected for declination.

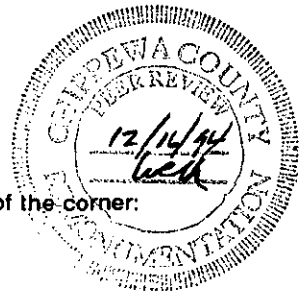

Signed by Keith R. Waters

Date 12-23-94

Surveyor's Michigan License No. 33142