

SURVEY & REMONUMENTATION

CHIPPEWA COUNTY REMONUMENTATION CORNER

APR 26 1995

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in **CHIPPEWA** COMMISSION

Located In: _____ Corner Code # _____


(County)

1. Public Land Survey T 45N R 1W K-10
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____
 3. Miscellaneous S _____ T _____
 Property in Sec. S _____ T _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

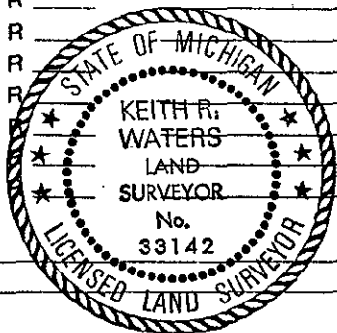

\$ 7.00 LAND CORNER
 \$ 2.00 MSSR
 19 JAN 95 4:18 P.M. RECEIPT# 2266
 RECEIVED FOR RECORD
 CHIPPEWA COUNTY - STATE OF MICHIGAN
 SHARON H. KENNEDY, REGISTER OF DEEDS
Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2				
3													
4	7		8		9		10		11		12		
5													
6	16		17		18		19		20		21		22
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Keith R. Waters in a field survey on December 12, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:


NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-10 1/4 Corner Common to Sections 25 & 26, T45N, R1W.
 Original ties to post: Sugar 12, S11°E 16 links Sugar 8, N52°W 11 links.
 1906 - A sketch of Section 26 found in County Surveyor records show this 1/4 corner being 2696 feet from section corner to the south and 2784 feet from section corner to the north.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-10 (T45N, R1W)
 This corner is being re-established as part of the Chippewa County Remonumentation Program.
 Found remains of a corner fence post next to a new fence corner, with fences running north and east. Distance to section north is 2805.96 feet, distance to section corner south is 2682.66 feet, and post is 41.5 feet west of a straight line between said section corners. Dimensions of sections in this area vary considerably from both GLO and County Surveyor notes. Accepted post as best available evidence of corner. Set a 3/4" rebar with an aluminum Chippewa County Remonumentation cap in center of post remains.

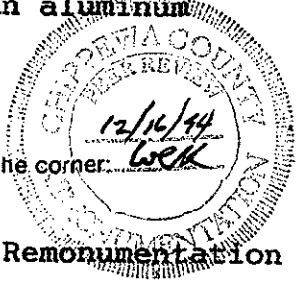

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-10 (T45N, R1W)
 Corner is a 3/4" x 24" rebar with an aluminum Chippewa County Remonumentation cap at the corner of fences north and east. Witnesses:
 New Corner Fence Post, S45°W
 5" Spruce, N21°E 18.98'
 12" Spruce, N63°W 47.85'
 21" Spruce, N81°W 73.94'
 Note: Distances are to a nail and tag in the side of the witness object. Trees are blazed and painted. Bearings are compass bearings corrected for declination.

Signed by Keith R. Waters Date 12-23-94
 Surveyor's Michigan License No. 33142