

**SURVEY &  
REMONUMENTATION**

**LAND CORNER RECORDATION CERTIFICATE**

**APR 07 1998**

**Filing Requirement of Act 74, Mich. P.A. 1970**

**Chippewa County Remonumentation Corner**

For corners in

**SECTION**  
Chippewa County

Located in:

Corner Code #

- |                                       |   |          |      |
|---------------------------------------|---|----------|------|
| 1. Public Land Survey                 |   | T45N R2W | D-11 |
|                                       |   | T        | R    |
|                                       |   | T        | R    |
|                                       |   | T        | R    |
| 2. Property Controlling<br>in Section | S | T        | R    |
|                                       | S | T        | R    |
| 3. Miscellaneous<br>Property in Sec.  | S | T        | R    |
|                                       | S | T        | R    |

4. Lot No. , Recorded Plat  
5. Private Claims

\$7.00 LAND CORNER  
\$2.00 MSSR  
6 Mar 1998 1:40:36 PM Receipt #6451  
RECEIVED FOR RECORD  
CHIPPEWA COUNTY - STATE OF MICHIGAN  
SHARON H. KENNEDY, REGISTER OF DEEDS

**BOOK 10 PAGE 176**

Register of Deeds Stamp & File Number

I, Keith R. Waters, in a field survey on October 27, 1997, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

D-11 1/4 Corner common to Sections 29 & 32, Town 45 North, Range 2 West

1849 - Original corner (cedar post) was established by Harvey Mellen, D.S.

Witnesses: Tamarack 12, N26°E 9 links  
Tamarack 14, N26°W 65 links

Found no evidence of subsequent restoration of this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being reestablished as part of the Chippewa County Remonumentation Program.

Found no evidence of this corner or its accessories. Reestablished corner on line between section corners 2632.24 feet east and 2622.33 feet west, on the extension of remains of an old fence line to the north. Corners falls in the approximate centerline of east-west gravel road.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed a 3/4" x 24" rebar with a plastic Chippewa County Remonumentation cap at the corner location, which fall in the approximate centerline of an east-west gravel road (17 Mile Road).

Witnesses:

- Power Pole, N04°E 45.26'
- Power Pole (E46), S65°W 57.86'
- Power Pole (E45-7M), S80°E 261.81'
- Power Pole (RU2-115-7), N82°E 286.50'


Note: Distances are to a nail/tag #33142 in the side of the pole.  
Bearings are compass bearings corrected for declination.

Signed by Keith R. Waters

Date 12-30-97

Surveyor's Michigan License No. 33142

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1995

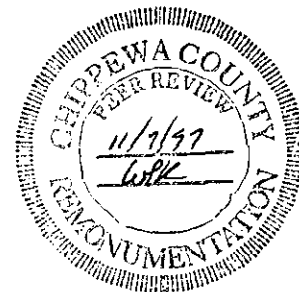

RECORDED TOP  
11/7/97 ✓