

APR 07 1998

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Chippewa County Remonumentation Corner

SECTION

For corners in

Chippewa County	Located in:	Corner Code #
1. Public Land Survey	T45N R2W	K-12
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. , Recorded Plat		
5. Private Claims		

\$7.00 LAND CORNER
\$2.00 MSSR
6 Mar 1998 2:07:05 PM Receipt #6451
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 10 PAGE 208

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	13		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Keith R. Waters, in a field survey on October 24, 1997, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K-12 1/4 Corner common to Sections 35 & 36, Town 45 North, Range 2 West

1849 - Original corner (cedar post) was established by Harvey Meilen, D.S.

Witnesses: Yellow Birch 12, N75°E 81 links

Cedar 8, S74°W 43 links

Found no evidence of subsequent restoration of this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being reestablished as part of the Chippewa County Remonumentation Program.

Found no evidence of this corner or its accessories. Reestablished corner by single proportionate measurement midway on line between section corners 2630.04 feet north and 2630.04 feet south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed a 3/4" x 24" rebar with a plastic Chippewa County Remonumentation cap at the corner location, which falls in the approximate centerline of a north-south 2 track road.

Witnesses:

5" Tamarack, N04°E 94.96'

16" Red Pine, S22°W 136.20'


14" Red Pine, S29°W 137.36'

5" Black Spruce, S36°W 131.12'

Note: Distances are to a nail/tag #33142 in the side of the tree.

Trees are blazed and painted.

Bearings are compass bearings corrected for declination.

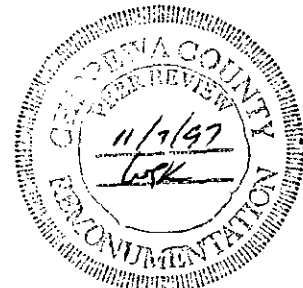

Signed by Keith R. Waters

Date 12-30-97

Surveyor's Michigan License No. 33142