

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Chippewa
 (County)

Located In: Corner Code #

1. Public Land Survey	T	R	_____
	T	R	_____
	T	R	_____
	T	R	_____
2. Property Controlling in Section	S 18	T 45N R 2W	13
	S 18	T 45N R 2W	16
3. Miscellaneous Property in Sec.	S	T	R
	S	T	R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 05 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7	●											
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


A. Description of original monument and accessories and/or subsequent restoration;
 (13-Sec. 18) Southeast 1/16 corner, Section 18. Not established in the original survey.
 (16-Sec. 18) East 1/16 corner between Sections 18 and 19. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(13-Sec. 18) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.
 (16-Sec. 18) Established the corner midway and on a straight line between Quarter corner 1319.09' west and Section corner 1319.09' east. From the corner thus established, the physical centerline of county road pavement is 1.5' south.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(13) Set 1 10x36 1. Pipe with 4" alum. MDNR cap. Blazed, scribed, and set measuring nails in:	(16) Set 1 10x36 1. Pipe with plastic cap stamped "MICH DMR PS33986". Blazed, scribed, and set meas. nails in:
5" Oak S68E 18.35' SE1/16 BT"	5" Oak N29E 40.85' E1/16 BT"
5" Maple S30E 7.8' do	12" R. Pine N20W 47.5' do
6" Maple S65W 15.55' do	10" Oak S40E 58.4' do
5" Maple N57E 15.25' do	6" Oak N45E 48.05' do
Cedar post adjacent. Bearings are magnetic. Distances to nail with tag.	Bearings are magnetic. Distances to nail with tag.

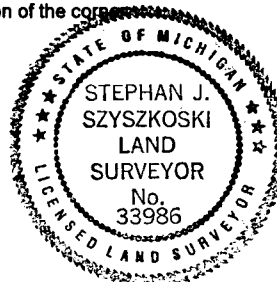

Signed by Stephan J. Szyszkoski Date 2/14/02
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Office of Property Management