

SURVEY &
REMONUMENTATION

1993

COMMISSION

Chippewa County Remonumentation Corner

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Chippewa
(County)

Located In:

Corner Code #

- | | | | | | | |
|------------------------------------|---|-----|---|----|------|--------|
| 1. Public Land Survey | T | 46N | R | 2W | A-1 | |
| | T | 47N | R | 2W | A-13 | Same |
| | T | 46N | R | 3W | M-1 | Corner |
| | T | 47N | R | 3W | M-13 | |
| 2. Property Controlling in Section | S | | T | | R | |
| | S | | T | | R | |
| 3. Miscellaneous Property In Sec. | S | | T | | R | |
| | S | | T | | R | |
4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

RECEIVED FOR RECORD
CHIPPEWA COUNTY
STATE OF MICHIGAN

93 NOV 31 AM 10:10

J. Roger Malott
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, William L. Karr, in a field survey on May 25, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(A-1) Corner of Sections 1, 6, 31, and 36, (Township Corner).

1979 Harold Y. Stockholm, L.S. 23519 Recorded in Liber 4, Page 26 of Corner Records. Found concrete monument with brass cap and (4) 1933 witnesses. Added sign and post East 1.0'.

14" Birch	N20°E	40.9'
13" Hemlock	S04°E	42.9'
15" White Pine	S75°W	117.5'
6" Cedar	N26°W	40.3'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(A-1) This corner is being perpetuated as part of the Chippewa County Remonumentation Program.


Found the record corner and four witnesses. Post and sign were gone. Blazes were grown over and previous distances appear to have been to the face of the blazes. Added nails and witness tags to the sides of the trees. Accepted corner position as found.

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

-C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(A-1) Corner is a 6" diameter concrete monument with brass cap stamped: T47N, R3W, R2W S. 36,31,6&1.

Witnesses: 16" Birch	N20°E	41.74'
13" Hemlock	S04°E	42.74'
17" White Pine	S75°W	117.24'
8" Cedar	N26°W	40.83'

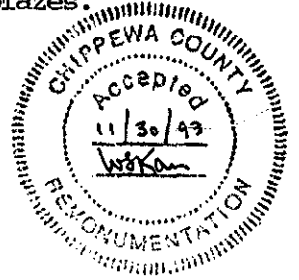

Signed by William L. Karr Date 11/29/93

Surveyor's Michigan License No. 27450

NOTE: Bearings are compass bearings corrected for declination. Distances are to a nail in side of witness objects unless noted.