

APR 07 1998

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Chippewa County Remonumentation Corner

SECTION

For corners in


Table with columns: Chippewa, Located In:, Corner Code #. Row 1: Public Land Survey, T 46N R 2W, B-11. Row 2: Property Controlling in Section, S T R. Row 3: Miscellaneous Property in Sec., S T R.

\$7.00 LAND CORNER
\$2.00 NSSR
12 Mar 1998 12:39:54 PM Receipt #6527
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS
BOOK 10 PAGE 219
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, William L. Karr, in a field survey on November 4, 1997, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

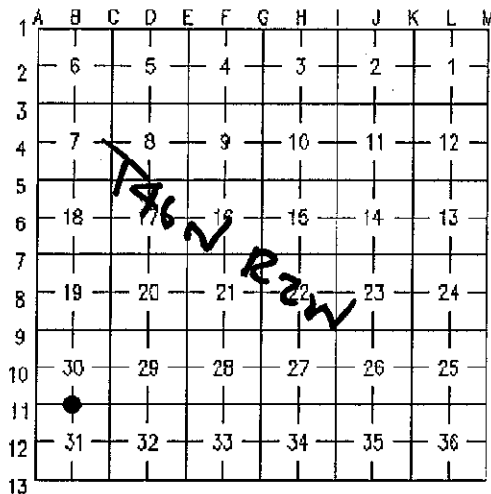

A. Description of original monument and accessories and/or subsequent restoration:

(B-11) 1/4 Corner Common to Sections 30 and 31, T.46 N., R.2 W.

1849 Harvey Mellen set Maple post in original survey. Witnesses: Maple 8 N42°E 13 W. Pine 26 S70°W 28

1995 Ron Bischer, P.S. 22428, set a 1/2" iron by single proportionate measurement, and established (4) witnesses.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(B-11) 1/4 Corner Common to Sections 30 and 31, T.46 N., R.2 W.

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.


Found no evidence of the original corner. Found the corner set by Bischer and all (4) witnesses. Measured distance to the East is 2617.30'; GLO - prorated distance to the East is 2616.14' (GLO was 2640'); measured distance to the West is 2580.31'; GLO - prorated distance to the West is 2581.47' (GLO was 2605.02'). Accepted the corner position as reestablished by Bischer and established (2) additional witnesses.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(B-11) 1/4 Corner Common to Sections 30 and 31, T.46 N., R.2 W.

Corner is a 1/2" iron with cap No. 22428 and is on an East-West brush line.

Table with columns: Witnesses, Bearing, Distance. Row 1: Balsam 6" N03°E 16.71'. Row 2: Balsam 4" N74°E 5.44' (existing). Row 3: Spruce 8" S68°E 14.65' (existing). Row 4: Maple 3" S42°W 18.85' (existing). Row 5: Balsam 8" S62°W 16.03'. Row 6: Maple 4" N58°W 11.00' (existing).

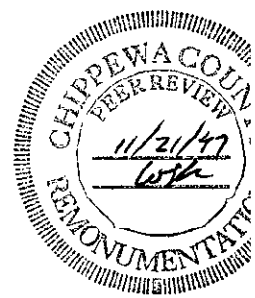

Signed by [Signature] Date 12/29/97

Surveyor's Michigan License No. 27450

NOTE: All bearings are compass bearings corrected for declination (6°W). All distances are to a nail and tag in the side of witness object unless otherwise noted.