

CHIPPEWA COUNTY REMONUMENTATION CORNER

MAR 27 1996

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

COMMISSION

Chippewa  
(County)

Located In:

Corner Code #

1. Public Land Survey

T46N R2W C-7

T R

T R

T R

2. Property Controlling  
in Section

S T R

S T R


3. Miscellaneous  
Property in Sec.

S T R

S T R

4. Lot No. , Recorded Plat

5. Private Claims

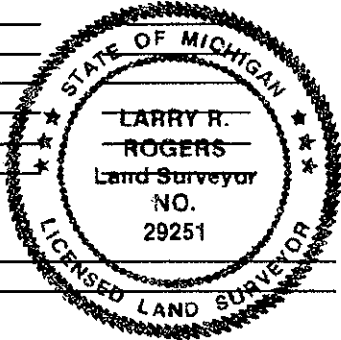

\$ 7.00 LAND CORNER

\$ 2.00 MSSR

29 FEB 96 9:28 A.M. RECEIPT# 462

RECEIVED FOR RECORD

CHIPPEWA COUNTY - STATE OF MICHIGAN

SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Larry R. Rogers, in a field survey on Oct. 10, 19 95 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(C-7) Southeast Corner of Section 18, T46N, R2W

1849: Harvey Mellen "set Sugar post at Corner of Sections 17, 18, 19 & 20" with the following witnesses:

12" Sugar S55E 11 links 28" Y. Birch N64W 9 links


1988: Neil E. Hill found brass cap on iron in monument box 3.8 feet North of centerline of M-28 as referenced in 1946 Highway Plans (L-55-B-5) and recorded in Liber 7, Page 81 of the Chippewa County Corner Records with the following witnesses:

S20°E 76.68' 7" Spruce North 104.38' 4" Poplar P.P. S35°W 71.22'  
S10°W 107.09' Center of B.M. disk on top of 6"x6" Conc. Post

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C-7) This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found no evidence of original corner position. Found 1/2" iron with cap #27447 in monument box 3.8 feet North of centerline of M-28 and 2 feet West of centerline of Tilson Road to South. Did not find brass cap in monument box. Existing witnesses (poplar gone). Accepted corner position as found and established two new witnesses.

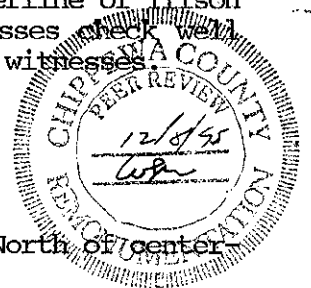

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C-7) Corner is 1/2" iron with P.S. cap #27447 in monument box 30.8 feet North of centerline of State Highway M-28.

Witnesses: 5" Maple	N32°W	124.70'
10" Spruce	N64°E	128.98'
7" Spruce	S22°E	76.60'
Utility Pole	S30°W	71.17'
Brass Disk on top of 6"x6" Conc. Right-of-way Marker	S18°W	107.10'

Signed by

Date 30 DEC 1995

Surveyor's Michigan License No.

29251

NOTE: Bearings are compass bearings corrected for declination. Distances are to a nail in side of witness objects unless noted.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1985