APR 0 7 1998 LAND CORNER RECORDATION CERTIFICATED LAND CORNER

Filing Requirement of Act 74, Mich. P.A. 197000 MSSR

SECTION

Chippewa County Remonumentation Corners Feb 1998 1:40:41 PM

Receipt #6148

For corners in

Chippewa County	Located in:			Corner Code #
Public Land Survey		T46N T T T	R1E R R	E-10
 Property Controlling in Section Miscellaneous Property in Sec. 	\$ \$ \$ \$	T T T	R R R R	

RECEIVED FOR RECORD CHIPPENA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS

PORK 10 PAGE 153

Register of Deeds Stamp & File Number


4. Lot No.

, Recorded Plat

5 Private Claims

I, William L. Karr, in a field survey on October 27, 1997, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the comer points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law: established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

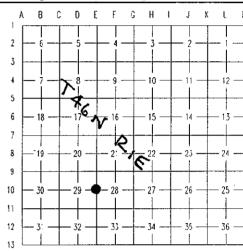

A. Description of original monument and accessories and/or subsequent restoration:

(E-10) 1/4 Corner Common to Sections 28 and 29, T. 46 N., R. 1 E.

J.H. Mullett set post for corner in the original survey. 1845

Witnesses:

10" Sugar Maple

S 60° W

18 lks

12" Sugar Maple N 32° E 28 lks 1902 F.H. Brown in field book and section drawing book in County Surveyors Office shows surveys in section 28. Brown notes that a post was set for the corner from original witnesses and that there is a large angle at the corner.

F.H. Brown in additional survey work in section 28 shows corner the same as in 1902. 1904

Corner tie book in the County Surveyors Office shows a post for corner 1.5' North of a fenceling West and 19?? the centerline of a drive to the East.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E-10) 1/4 Corner Common to Sections 28 and 29, T. 46 N., R. 1 E.

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found no evidence of the original corner. Reestablished the corner mid-way between the right-of-way ferices proportionate County Surveyor distances to the section corners to the North, 2689' (c.s.), 2693.35' (m) and South, 2649' (c.s.), 2653.33' (m). This position falls on the range of a fence to the West and also works with the County Surveyor distance to the 1/4 corner to the East, 5446' (c.s.), 5439.3' (m).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E-10) 1/4 Corner Common to Sections 28 and 29, T. 46 N., R. 1 E.

Corner is a 3/4" x 24" re-bar with plastic remon Chippewa County Remonumentation Cap set 0.5' below corner falls 9' West of the centerline of North-South Shunk Rd., and on the range of a fence West

Witnesses: Power Pole "A" N 54° E 59.03' **Corner Fence Post** S 34° E 78.22' **Fence Post** S 37° W 79.17 S 51° W Witness Pipe 65.97 17.17

N 81° W Power Pole DR1/76/21 Witness Pipe N 39° W 48.61'

LAND Note: The Witness Pipes are 3/4" x 24" pipes with pipe caps set 1' below grade, the angle between the pipes being 89° 24' 04".

Bearings are compass bearings, corrected for declination, all distances are to a nail and tag in the side of the witness object unless otherwise noted.

Signed by

12/23/97

Surveyor's Michigan License No. 27450

KARR

LAND

SURVEYOR

No.

27450