

**SURVEY &
REMONUMENTATION CHIPPEWA COUNTY REMONUMENTATION CORNER**

APR 27 1995

**LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in
Chippewa **COMMISSION**
(County)

Located In: Corner Code #

1. Public Land Survey	T <u>46N</u> R <u>1W</u>	<u>A-7</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

\$ 7.00 LAND CORNER
\$ 2.00 MSSR
19 DEC 94 10:15 A.M. RECEIVED FOR RECORD
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2								
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William L. Karr, in a field survey on October 19, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(A-7) Section Corner common to Sections 18 & 19 (T.46 N., R.1 W.) and Sections 13 & 24 (T.46 N., R.2 W.)

1845: J. Mullett set post cor to secs. 13 & 24 T46N R2W
Spruce 10 S63W 12 lks Tamarack 12 S14E 16
Spruce 6 N40W 32 lks Spruce 10 N22E 09

1941: Cedar Post found in road intersection

? : T.M. Kelly set a 1/2" iron from R.O.W. plans and witnessed.

1988: N.E. Hill found a 1/2" iron w/cap No. 24599, 18.8' North of the road centerline and accepted as found. He also set a monument box and recorded in L.07, P.075 of the corner records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(A-7) This corner is being perpetuated as part of the Chippewa County Remonumentation program.

Found no evidence of original corner. Found a 1/2" iron w/cap No. 24599 in a monument box, 18.8' North of the centerline of M-28. We found all (4) witnesses as recorded in L.07, P.075 and added (2) witnesses. Accepted corner as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner
(A-7) Corner is a 1/2" iron with plastic cap No. 24599 in a monument box, 18.8' North of the centerline of M-28.

Witnesses: Center-top telephone box
"v" notch @ E. end of 12" cmp
P. Pole (DR4/74)
Chiseled "x" NW corner H.wall
Chiseled "x" SE corner H.wall
P. Pole (DR4/74/1)

N55°E 65.57'
S19°E 55.94'
S22°W 60.02'
S50°W 84.21'
N60°W 54.67'
N24°W 76.86'

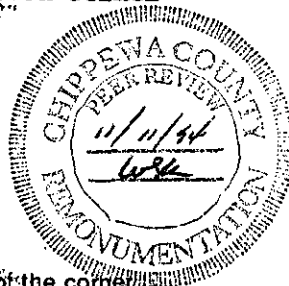

Signed by William L. Karr Date 12/7/94

Surveyor's Michigan License No. 27450

723-12

NOTE: Bearings are compass bearings corrected for declination.
Distances are to a nail in side of witness objects unless noted.