

MAY 28 1997

CHIPPEWA COUNTY REMONUMENTATION CORNER

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Chippewa (County)	Located In:	Corner Code #
1. Public Land Survey	T46N R 1W	C-2
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

\$7.00 LAND CORNER

\$2.00 MSSR

2/28/1997 4:18:22 PM Receipt #226
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 9 PAGE 393

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Keith R. Waters, in a field survey on 12/06, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		●	5		4		3		2		1	
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:

C-2 1/4 Corner Common to Sections 5 & 6, Town 46 North, Range 1 West
1845 - Original ties (James Mullett): Birch 6, N38°W 23 links - Fir 6, S60°E 08 links.
1905 - County Surveyor Frederick H. Brown notes indicate a set post from an original bearing tree.



B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being re-established as part of the Chippewa County Remonumentation Program. Found no evidence of corner. Re-established corner by single proportionate measurement according to the original GLO notes on line between section corner to the south and closing corner on the township line to the north. Corner position falls on the approximate extension of the remains of an old fence line to the east.

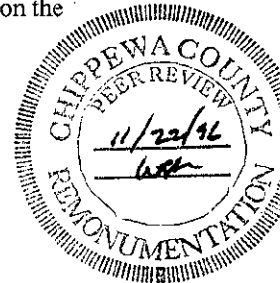

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" x 24" rebar with a stamped aluminum Chippewa County Remonumentation cap on the easterly slope of a ravine.
Witnesses:
4" Spruce, S01°E 11.32'
6" Balsam Fir, N23°E 41.22'
7" Balsam Fir, N71°E 44.62'
5" Maple, N10°W 23.40'

Note: Unless noted otherwise, distances are to a nail/tag #33142 in the side of the witness object. Bearings are compass bearings corrected for declination. Trees are blazed and painted.

Signed by Keith R. Waters
Surveyor's Michigan License No. 33142

Date 12-30-96

BOOK 9 PAGE 393