

# SURVEY & REMONUMENTATION

APR 27 1995

COMMISSION

CHIPPEWA COUNTY REMONUMENTATION CORNER

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Chippewa</u> <small>(County)</small>	Located In:	Corner Code ##	
1. Public Land Survey	T <u>46N</u> R <u>1W</u>	<u>C-13</u>	
	T _____ R _____	_____	
	T _____ R _____	_____	
	T _____ R _____	_____	
2. Property Controlling in Section	S _____ T _____ R _____	_____	
	S _____ T _____ R _____	_____	
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____	
	S _____ T _____ R _____	_____	
4. Lot No. _____, Recorded Plat _____			
5. Private Claims _____			

\$ 7.00 LAND CORNER  
\$ 2.00 MSSR  
5 DEC 94 12:23 P.M. RECEIPT# 1518  
RECEIVED FOR RECORD  
CHIPPEWA COUNTY - STATE OF MICHIGAN  
SHARON H. KENNEDY, REGISTER OF DEEDS  
Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

T46N R1W


I, William L. Karr, in a field survey on October 28, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

(C-13) Standard Corner Sections 31/32, T.46 N., R.1 W.

<u>1840 Austin Burt set post.</u>	Birch	20	N07E	27
	Hem	16	N43W	09

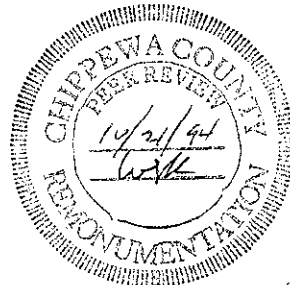

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C-13) This corner is being re-established as part of the Chippewa County Remonumentation program.

Found no evidence of original corner. Found remains of a North-South 1/4 line fences in Sections 31 and 32. Distance between fences was 5274.58'. I split this distance and re-established Standard Corner 31/32 on the Township line using the Township corner and Standard Corner 32/33. (1/2" iron in concrete)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C-13) Corner is a 3/4"x 24" iron with aluminum "Chippewa County Remonumentation" cap and falls approximately 25' West of the centerline of a North-South trail.

Witnesses: 10" Maple	N63°W	10.91'
8" Spruce	S55°W	14.62'
12" Jack Pine	S53°E	42.68'
14" Jack Pine	N39°E	80.14'
Closing Corner 5/6	East	25.08'



Signed by William L. Karr Date 12/21/94

Surveyor's Michigan License No. 27450

NOTE: Bearings are compass bearings corrected for declination.  
Distances are to a nail in side of witness objects unless noted.