

MAY 28 1997

CHIPPEWA COUNTY REMONUMENTATION CORNER

COMMISSIONER

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 \$7.00 RECORDING FEE

For corners in

Chippewa

(County)

Located In:

Corner Code #

1. Public Land Survey

T46N R 1W

F-5

T R

T R

T R

2. Property Controlling in Section

S

T R

S

T R

3. Miscellaneous Property in Sec.

S

T R

S

T R

4. Lot No. , Recorded Plat

5. Private Claims



\$2.00 MSSR

3/3/1997 5:06:36 PM Receipt #275
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 10 PAGE 16

Register of Deeds Stamp & File Number

Grid with columns A-L and rows 1-13. A dot is marked at row 5, column F.

I, Keith R. Waters, in a field survey on 11/17, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

F-5 1/4 Corner Common to Sections 9 & 16, Town 46 North, Range 1 West

1845 - Original corner (James Mullett) was a 10" Fir.


1890 - County Surveyor Frederick H. Brown notes indicate that the original 1/4 corner was gone and that he re-established the corner midway between original section corners 2734 feet east and west.

Witnesses: 9" Cedar, S30 1/2° E 7.5' - 10" Cedar, N16° W 29'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being re-established as part of the Chippewa County Remonumentation Program.

Found no evidence of corner. Re-established corner by single proportionate measurement on line between section corners 2630.0 feet east and 2630.0 feet west. Position is 33 feet north of the remains of an east-west right-of-way fence on the south side of a seasonal road (8 Mile Road). East-west position is at the approximate split of the remains of north-south fence lines on each side of a 1 rod wide farm lane running south from this 1/4 corner. The extension of a new fence line to the north is approximately 3.5 feet west.

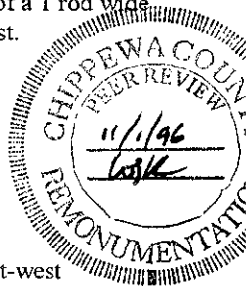

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" x 24" rebar with a plastic Chippewa County Remonumentation cap 2 feet north of the north edge of an east-west seasonal road (8 Mile Road). Witnesses:

16" White Birch, N28° W 35.93'

Corner Fence Post, N04° W 26.05'

4" White Birch, S45° E 88.02'

5" Aspen, S79° W 47.83'

Note: Unless noted otherwise, distances are to a nail/tag #33142 in the side of the witness object. Bearings are compass bearings corrected for declination. Trees are blazed and painted.

Signed by Keith R. Waters

Date 12-30-96

Surveyor's Michigan License No. 33142

BOOK 10 PAGE 16