MAR 0 9 1994

Chippewa County Remonumentation Corner

RECEIVED FOR RECORD CHIPPEWA COUNTY STATE OF MICHIGAN

COMMISSIE

Property in Sec.

Lot No. . Private Claims _ LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

93 DEC 29 AM 10: 24

For corners in		, ,	
_	Chippewa	Located In:	Corner Code =##
	(County)		
1.	Public Land Survey	T_46N R_1W	_K-1
		T R	
		T R	
		T R	
2.	Property Controlling	S T R	
	in Section	S T R	
3.	Miscellaneous	S T A	


Register of Deeds Stamp & File Number

<u>William L. Karr</u>, in a field survey on __ December 17 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned

S ____ T ___ R ____

____ , Recorded Plat ___

in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

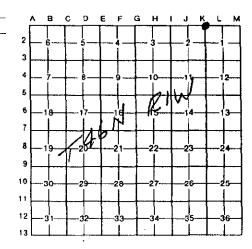

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 - (K-1) Closing Corner Common to Sections 1 & 2 (T46N-R1W)

1845: J.H. Mullett, D.S. - set post 12 links West of Standard Corner

S24°E 10" Birch 22 links 12" Maple S30°W 56 links

1960: J.P. Smallwood, Michigan Highway Department.

Recorded as Common Corner in Liber 3, Page 236 of the Chippewa County Corner Records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found 14" O.D. pipe with PK nail in it. Pipe fell on the extension of afence line to the South. Corner was determined to be Closing Corner 2/1. Distance West to the North & corner of Section 2 matched quite closely with old County Surveyor distance Accepted corner position as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: Corner is a 14" O.D. pipe with PK nail in center. Falls on approximate centerline of Six Mile Road on the extension of a field line to the South.

Witnesses:

Power Pole (126/1)	N79°E	176.94'
Standard Corner 35/36	East	7.92'
Power Pole	S75°E	157.61'
Corner (Metal) Fence Post	South	38.987
Corner (Metal) Fence Post	S46°W	63.19'
Anchor Pole (126/2)	N40°W	34.53'

KARR LAND SURVEY**OR** No.

Signed by

27450 Surveyor's Michigan License No. 27450

NOTE: Bearings are compass bearings corrected for declination. 27450 REVISED MAY 14, 1975 Distances are to a nail in side of witness objects unless noted. REVISED JAN., 1983