MAY 28 1997

LAND CORNER RECORDATION CERTIFICATE

COMMISSION

Filing Requirement of Act 74, Mich. P.A. 1970 Chippewa County Remonumentation Corner \$7,00 LAND CORNER

For corners in

Chippewa County	Located	l in:		Corner Code #
Public Land Survey		T46N T46N T	R1E R2E R	M-12 Same A-12 Corner
(3' "'	S	Ţ	R	
	S	T	R	
3. Miscellaneous property in Sec.	S S	T T	R R	

\$2.00 MSSR

2/28/1997 2:47:05 PH Receipt #217 RECEIVED FOR RECORD

CHIPPENA DOUATY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF CEEDS

BOOK 9 PAGE 349

Register of Deeds Stamp & File Number


Lot No. . Recorded Plat

5. Private Claims

I, William L. Karr, in a field survey on December 4, 1996, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

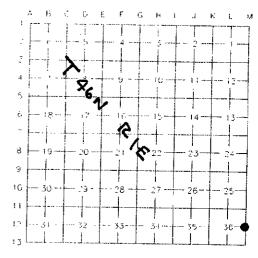

(M-12) 1/4 Corner Common to Section 36, T. 46 N., R. 1 E., and Section 31, T. 46 N., R. 2 E.

1845 J.H. Mullett set post in original survey.

1910 F.H. Brown in field notes in County Surveyors Office. Brown ran the line between sections 36 and 31 were He shows the distance on the mile as 5324' and evenly divided.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(M-12) 1/4 Corner Common to Section 36, T. 46 N., R. 1 E., and Section 31, T. 46 N., R. 2 E. This corner is being reestablished as part of the Chippewa County Remonumentation Program.

E VUMEN This corner is being reestablished as part of the Chippewa County Remonumentation Program.

Found a 1/2" iron in the centerline, and a small pipe on the West edge of the North-South road, 2640' South of the N.E. corner of section 36. Testimony from property owner in the S.E. quarter of section 36 revealed that the iron was set by the people improving the south half mile of the road.

Overall mile measures 5319.84. Reestablished the 1/4 corner mid-way and on-line between the section corners to the North and South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(M-12) 1/4 Corner Common to Section 36, T. 46 N., R. 1 E., and Section 31, T. 46 N., R. 2 E.

Corner is a 3/4" x 24" re-bar with plastic Chippewa County Remonumentation Cap in centerline of North-South two track road.

Witnesses:

8" Spruce S 52° E 34.56 20" Maple S 55° W 56.60 9" Spruce S 86° W 45.67 10" Maple N 71° W 44.44'

KARR LAND SURVEYOR

Bearings are compass bearings, corrected for declination, all distances are to a nail and tag in the side of otherwise noted.

Signed by

Surveyor's Michigan License No. 27450

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL BURVEYORS, JAN. 28, 1971

REVISED JAN