LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970


Chippewa County Remonumentation Corner

SECTION		1	\$7.00 LAND CORNER
Chippewa	Located In:	Corner Code #	\$2.00 MSSR
1. Public Land Survey	T <u>46N</u> R <u>2E</u> T R T R	<u>C-5</u>	21 JAN 1999 10:15:53 AM Receipt #13123 RECEIVED FOR RECORD CHIPPEWA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS
 Property Controlling in Section Miscellaneous Property in Sec. 	S T R S T R S T R S T R		BOOK 10 PAGE 337 Register of Deeds Stemp & File Number

4. Lot No. , Recorded Plat 5. Private Claims

I, Larry R. Rogers in a field survey on October 15, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

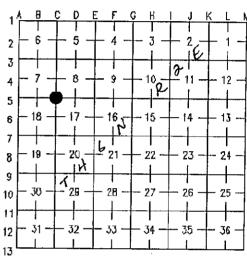

A. Description of original monument and accessories and/or subsequent restoration:

(C-5) Northeast Corner, Section 18, Township 46 North, Range 2 East.

The original corner was placed in 1845 by James H. Mullett. County Surveyor notes show 1 1/4" x 30" bolt with square head down and 6" x 4 1/2 foot cedar post. In 1922, the Section Corner is shown as the Point of Beginning for the Plat of "Clover Beach Subdivision" as recorded in Liber 4 of Plats at Page 6 of Chippewa County Records. A 1975 B.L.M. dependent resurvey found the 1 1/4" x 30" iron bolt and replaced with a 2 1/2" iron pip with stamped brass cap set flush with ground. In 1982, William L. Karr, P.S. 27450 recovered the B.L.M. brass capped iron pipe and B.L.M. witnesses and filed a L.C.R.C. in Liber 6, Page 096 of the Chippewa County Corner Records. In 1992, Lawrence Weinreis, P.S. 32343 recovered same corner, added one new witness and filed a L.C.R.C in Liber 7, Page 412 of the Chienewal County Corner Records.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C-5) Northeast Corner, Section 18, Township 46 North, Range 2 East.

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Recovered a B.L.M. 2 1/2" diameter iron pipe with stamped brass cap 2" below grade. Earlier 1 1/4" bolt is now 0.5 feet North of B.L.M. corner. Recovered three Weinreis witnesses and added two others. Accepted corner position as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: (C-5) Northeast Corner, Section 18, Township 46 North, Range 2 East.

Corner is a B.L.M. 2 1/2" diameter iron pipe with stamped brass cap 2" below grade.

Witnesses:

14" Maple 10" Maple

N48 E N70°E

34.30 feet 39.05 feet (previous 39.10 feet)

10" Triple Maple S74"E 6° Twin White Birch S01°F

43.83 feet (previous 43.86 feet) 23.30 feet (previous 23.34 feet)

Steel Fence Post

North

30 DEC 1998

Signed by Date _

LARRY R. ROGERS Land Surveyor NO. 29251

LAND

MICHIG

Surveyor's Michigan License No. 29251

NOTE: All bearings are compass bearings corrected for declination (6'W). All distances are to a nail and tag in the side of witness object unless otherwise noted.